HEIDENHAIN



Options and Accessories

For TNC Controls

www.heidenhain.com/cnc-controls

Options and accessories for TNC controls

Table of contents

Overview

HEIDENHAIN controls are known for their complete range of features and extensive functionality. Thanks to a series of control options and accessories, they can also be optimally adapted to the given application. This brochure provides a broad overview of the available options and the most important hardware enhancements for the current control versions. Along with a detailed description of its functionality, each option or hardware enhancement contains a list of the software versions with which it is available.

Options are functions already integrated into the control, allowing you to tailor the TNC's functionality to your specific needs at any time. Some options, however, must be adapted by the machine manufacturer. Options are conveniently enabled via a keyword. The software options are saved on the SIK plug-in board. The TNC7 and TNC7 basic can be operated with the present SIK or, in the future, with the new SIK2.

The SIK2 plug-in board is available starting from these software versions: TNC7: 81762x-18 SP1 TNC7 basic: 81762x-18 SP1

HEIDENHAIN offers **software** as practical tools for applications external to the TNC, from supporting data transfer or creating a PLC program all the way to a complete programming station.

Hardware enhancements make work on the machine easier, faster, and more reliable. An electronic handwheel, for example, permits fine manual control, and a workpiece touch probe significantly reduces workpiece setup times.

The version schema was simplified, starting with NC software version 16:

- The publication period determines the version number.
- All control models of a publication period have the same version number.
- The version number of the programming stations corresponds to the version number of the NC software.



Dynamic Precision Dynamic Efficiency Connected Machining Digital Shop Floor Options Programming and oper Machine accuracy Machining functions Communication Adaptation to the mach Software

Overview tables

Hardware enhancements

Please also note the page references in the overview tables.

	4
	10
	11
	12
	13
ration	14
	34
	41
	53
hine	56
	63
	78

Overview

Option num		Option	20	20	40		basic	Page
SIK	SIK2		TNC 320	TNC 620	TNC 640	TNC7	TNC7 basic	
		Machining functions						
8	1-01-1	 Adv. Function Set 1 Programming rotary-table machining Programming cylindrical contours on an unrolled cylinder Feed rate in mm/min or degrees/min 	•	•	•	•	•	14
		 Adv. Function Set 1 Coordinate conversion Tilting the working plane, PLANE function 	•	•	•	•	•	15
		 Adv. Function Set 1 Interpolation Circular in 3 axes with tilted working plane 	•	•	•	•	•	15
9	4-01-1	Adv. Function Set 2 Interpolation • Linear in 5 axes	-	•	•	•	•	-
		 Adv. Function Set 2 5-axis simultaneous machining 3D tool compensation via surface normal vectors Changing the swivel-head angle with the electronic handwheel during program run without affecting the tool tip position (TCPM = Tool Center Point Management) Keeping the tool perpendicular to the contour Tool radius compensation perpendicular to the tool direction Manual traverse in the active tool-axis system 	-	•	•	•	_	41
17	1-05-1	 Touch Probe Functions Streamlining setup and inspection with probing cycles Workpiece misalignment compensation, preset setting Automatic tool and workpiece measurement Touch-probe input enabling for non-HEIDENHAIN systems 	 ✓ 	•	~	~	•	16
19	-	Advanced Programming Features Expanded programming capabilities • FK free contour programming • Canned cycles • Peck drilling, reaming, boring, counterboring, centering • Milling internal and external threads • Clearing level and oblique surfaces • Multi-operation machining of straight and circular slots • Complete machining of rectangular and circular pockets • Circular and linear point patterns • Contour train, contour pocket, including contour-parallel machining • Integration of cycles created by machine manufacturer • Engraving cycle: engrave text or numbers in a straight line or on an arc • Contour slot with trochoidal milling	 Image: A start of the start of	•	~	~	~	18
20	-	 Advanced Graphic Features Visualization for verification and program run Plan view Projection in multiple planes 3D view 	v	•	~	~	~	19
		Advanced Graphic Features Detailed 3D visualization	~	•	~	~	~	20
21	4-02-1	Adv. Function Set 3 Superimposing handwheel positioning during program run	~	•	~	~	•	42
		Adv. Function Set 3 Calculating contours with tool-radius offset in advance (LOOK AHEAD)	✓	•	~	~	•	43

Option numl	ber	Option	TNC 320	TNC 620	TNC 640	2	TNC7 basic	Page
SIK	SIK2		TNC	TNC	TNC	TNC7	TNC	
		Machining functions						
22	-	Pallet Management Orchestrating automated pallet machining	-	~	~	~	~	21
40	5-03-1	Collision Monitoring Preventing crashes with dynamic collision monitoring (DCM)	-	-	•	•	•	44
42	1-03-1	CAD Import DXF converter, importing contours and machining positions from DXF files	•	•	•	•	•	23
		CAD Import Importing contours from 3D models	•	•	•	•	•	24
44	1-06-1	Global PGM Settings Applying configurable settings to entire programs	-	-	•	•	-	46
45	2-31-1	Adaptive Feed Contr. Ensuring optimized feed rates (AFC)	-	-	•	•	•	47
50	4-03-1	 Turning Mill-turning functions Turning tool management Tool radius compensation Switching between milling and turning mode Turning-specific contour elements Turning cycle package 	_	-	•	•	_	26
		Turning Eccentric turning	-	-	•	•	-	27
92	2-02-1	3D-ToolComp 3D radius offset based on tool angle (requires the Adv. Function Set 2 software option)	-	-	•	•	-	52
93	2-03-1	Ext. Tool Management Managing tools based on NC program requirements	•	•	•	•	•	29
96	7-04-1	Adv. Spindle Interpol. Machining circular features with interpolation turning	-	-	•	•	-	30
131	7-02-1	 Spindle Synchronism Synchronizing spindle motion Synchronization of two or more spindles Hobbing cycle (additionally requires the Turning option) 	-	-	•	•	_	31
140	5-03-2	Collision Monitoring v2 DCM version 2 for crash prevention (automatically enables the Collision Monitoring software option)	-	-	-	•	•	45
145	2-30-1	Active Chatter Contr. Reducing chatter during roughing (ACC)	-	•	•	•	•	48
152	1-04-1	 CAD Model Optimizer Cleaning up 3D models for use on the control Generate correct STL files from STEP files Repair existing STL files 	_	•	•	•	•	25
154	2-05-1	Batch Process Mngr. Informative overview of the pallet lineup	-	•	•	•	•	22
156	4-04-1	Grinding Cycles for jig grinding	-	-	•	•	-	32
157	4-05-1	Gear Cutting Creating gears	-	-	•	•	-	33
158	4-03-2	Turning v2 Version 2 of the mill-turning functions (automatically enables the Turning option)	-	-	•	•	-	28
159	1-07-1	Model Aided Setup Graphically supported workpiece setup	-	-	-	•	•	17
167	1-02-1	Opt. Contour Milling Optimized trochoidal milling (OCM)	•	•	•	•	•	49

■ Available as option
 − = Not available
 ✓ = Standard function

Overview

Optio	on	Option						U	Page
num SIK				TNC 320	TNC 620	TNC 640	TNC7	TNC7 basic	
		Machine accuracy		<u> </u>					
48	2-01-1	KinematicsOpt Touch probe cycles for auton rotary axes	natic calibration measurements on	-	•	•	•	•	34
52	2-04-1	KinematicsComp Correcting 3D spatial error	S	-	-	•	•	-	35
141	2-20-1	Cross Talk Comp. Correcting errors due to co	pupled axes (CTC)	-	•	•	•	•	36
142	2-21-1	Position Adapt. Contr. Adapting machine par	rameters based on position (PAC)	-	•	•	•	•	37
143	2-22-1	Load Adapt. Contr. Adapting machine param loads (LAC)	eters based on workpiece-related	-	•	•	•	•	38
144	2-23-1	Motion Adapt. Contr. Adapting machine para (MAC)	ameters based on axis movements	-	•	•	•	•	39
146	2-24-1	Machine Vibr. Contr. Damping machine vibrations (MVC)					•	•	40
155	5-02-1	Component Monitoring Monitoring loads on machine components					•	•	50
168	5-01-1	Process Monitoring Monitoring the production process based on a teach-in cut				-	•	-	51
		Communication			1	1		1	1
18	3-03-1	HEIDENHAIN DNC Communicating with external Windows applications via COM component			•	•	•	•	54
56 - 61	3-02-1*	OPC UA NC Server Standardized interface for within a network	or accessing TNC data and functions	-	•	•	•	•	53
133	3-01-1	Remote Desk. Manager Viewing and remote (e.g., Windows PCs)	ely operating external computers	•	•	•	•	•	55
		Machine interfacing		1	1	1	1	1	1
0	6-01-1*	Control Loop Oty. (Additional Axis 1-8) Additional control loops	Additional Axis 1	•	•	•	•	•	56
1			Additional Axis 2	•	•	•	•	•	
2	-		Additional Axis 3	-	•	•	•	•	
3	-		Additional Axis 4	-	•	•	•	•	
4	-		Additional Axis 5	-	-	•	•	-	
5	-		Additional Axis 6	-	-	•	•	-	
6	-		Additional Axis 7	-	-	•	•	-	-
7	-		Additional Axis 8	-	-	•	•	-	

Optio num SIK		Option	TNC 320	TNC 620	TNC 640	TNC7	TNC7 basic	Page
		Machine interfacing	H	F	F	F	F	
24	6-03-1	Gantry Axes Operating synchronized axes: gantry axes, tandem tables	•	•	✓	✓	•	58
46	7-01-1	Python OEM Process Implementing Python OEM applications	•	•	•	•	•	59
49	6-02-1	Double Speed Axes Double-speed control loops	-	•	•	•	•	60
77	6-01-1*	4 Additional Axes 4 additional control loops	-	-	•	•	•	56
78		8 Additional Axes 8 additional control loops	-	-	•	•	-	
101 - 130	-	OEM Option Enabling options provided by the OEM	-	-	•	-	-	61
135	7-03-1	Synchronizing Functions Real-time coupling (RTC) for synchronizing axes and spindles	-	-	•	•	_	62
160	6-30-1	Integrated FS: Basic Gen 3 exclusive: enabling of functional safety (FS) and four safe control loops	-	•	•	•	•	57
161	6-30-2*	Integrated FS: Full Gen 3 exclusive: enabling functional safety (FS) and the maximum number of functionally safe control loops (10 or more)	-	•	•	•	•	
162		FS Control Loop Qty. (Add. FS Ctrl. Loop 1) Gen 3 exclusive: additional functionally safe control loop (no. 1)	-	•	•	•	•	
163		FS Control Loop Qty. (Add. FS Ctrl. Loop 2) Gen 3 exclusive: additional functionally safe control loop (no. 2)	-	•	•	•	•	
164		FS Control Loop Qty. (Add. FS Ctrl. Loop 3) Gen 3 exclusive: additional functionally safe control loop (no. 3)	-	•	•	•	•	
165		FS Control Loop Qty. (Add. FS Ctrl. Loop 4) Gen 3 exclusive: additional functionally safe control loop (no. 4)	-	•	•	•	•	
166		FS Control Loop Qty. (Add. FS Ctrl. Loop 5) Gen 3 exclusive: additional functionally safe control loop (no. 5)	-	•	•	•	•	
169		FS Control Loop Oty. (Add. FS Full) Gen 3 exclusive: remaining functionally safe control loops enabled	-	•	•	•	•	

* This software option can be ordered multiple times in the desired quantity. The control automatically takes all enablings into account.

 \checkmark = Standard function

* This software option can be ordered multiple times in the desired quantity. The control automatically takes all enablings into account.

- = Available as option
- = Not available
- \checkmark = Standard function

Overview

Software	TNC 320	TNC 620	TNC 640	TNC7	TNC7 basic	Subject to a charge	Page
ConfigDesign Configuration of the machine parameters	•	•	•	•	•		-
PCtoolsUpdateManager Update manager for HEIDENHAIN software	•	•	•	•	•		-
PLCtext Editing and managing of language-sensitive texts	•	•	•	•	•		-
TNCanalyzer Analysis and evaluation of service files	•	•	•	•	•		-
TNC OEMOption Key generator for enabling options for a limited time	•	•	•	•	•		-
TNC OEMNumber Day code generator for the machine manufacturer area	•	•	•	•	•		-
TNCtest Creation and execution of acceptance tests	•	•	•	•	•		-
RemoTools SDK Function library for the development of one's own communication applications (requires the HEIDENHAIN DNC software option)	•	•	•	•	•	•	54
TNCremo Data transfer software	•	•	•	•	•		63
TNCremoPlus Data transfer software with "live" screen	•	•	•	•	•	•	63
RemoteAccess Software for remote diagnostics	•	•	•	•	•	•	64
PLCdesign PLC diagnostics for all HEIDENHAIN controls	•	•	•	•	•		65
StateMonitor Collect and evaluate machine data	•	•	•	•	•	•	66
KinematicsDesign Creation of kinematic models for numerical controls	•	•	•	•	•		68
M3D Converter Creation of high-resolution collision objects	•	•	•	•	•	•	68
CycleDesign Incorporation of developed NC subprograms as cycles	•	•	•	•	•		69
TNCscope Recording and evaluation of, for example, axis curves of HEIDENHAIN controls	•	•	•	•	•		70
TNCdiag Evaluation of diagnostic information of digital motor systems	-	•	•	•	•		71
TNCopt Initial setup of digital control loops	-	•	•	•	•		72
IOconfig Configuration of, for example, handwheels	•	•	•	•	•		73
Software Key Generator / Web application For enabling of software options	•	•	•	•	•		74
BMXdesign Designing language-sensitive soft keys	•	•	•	•	•		75
Programming station	•	•	•	•	-		76
virtualTNC For PC-based machine simulation	-	•	•	•	-	•	77

Hardware enhancements			TNC 320	TNC 620	TNC 640	TNC7	TNC7 basic	Must be adapted by the OEM	ID	Page
Handwheel	HR 130 TTL; panel mounted	with detent w/o detent	•	•	•	•	•	No	540940-01 540940-03	78
	HR 510 portable handwheel	with detent w/o detent	•	•	•	•	•	No	1120313-xx 1119971-xx	
	HR 510 FS portable handwheel	with detent w/o detent	•	•	•	•	•	No	1119974-xx 1120311-xx	
	HR 520 portable handwheel with display	with detent w/o detent	•	•	•	•	•	No	670303-xx 670302-xx	
	HR 520FS portable handwheel with display	with detent w/o detent	•	•	•	•	•	No	670305-xx 670304-xx	
	HR 550FS portable radio handwheel with display	with detent w/o detent	•	•	•	•	•	No	1183021-xx 1200495-xx	
	HRA 551FS handwheel hold	ler for HR 550FS	•	•	•	•	•	No	1119052-xx	
Workpiece touch probe	TS 260 with cable		•	•	•	•	•	Yes	738283-xx	79
	TS 460 with radio or infrared	transmission	•	•	•	•	•	Yes	1178530-xx	
	TS 642 with infrared transmi	ssion	•	•	•	•	•	Yes	653217-xx	
	TS 760 with radio or infrared	transmission	-	•	•	•	•	Yes	1283267-xx	
Tool touch probe	TT 160 with cable		•	•	•	•	•	Yes	729763-xx	80
	TT 460 with radio or infrared	transmission	•	•	•	•	•	Yes	1192582-xx	
Additional operating station	ITC 362 with 24-inch touchso	creen	-	-	•	•	-	Yes	1346871-xx	81
station	ITC 855 with 15-inch touchson ASCII keyboard	creen and	-	•	•	-	-	Yes	1370459-xx	
	ITC 860 with 19-inch touchso separate TNC keyboard requi		-	-	•	-	-	Yes	1174935-xx	
	ITC 352 with 19-inch touchso	creen	-	-	-	•	-	Yes	1374639-xx	
	ITC 342 with 16-inch touchso	creen	-	-	-	-	•	Yes	1354570-xx	
Industrial PC	IPC 306 with 8 GB RAM		-	•	•	•	•	Yes	1179966-01	82
Vision system	VT 121/VT 122 for tool inspe	ection	-	-	•	•	•	Yes	1249466-01	83

■ Available as option
 − = Not available
 ✓ = Standard function

■ Available as option
 − = Not available
 ✓ = Standard function

Overview Dynamic Precision

dynamic precision

Dynamic Efficiency

The concept of Dynamic Precision comprises optional functions for HEIDENHAIN controls that effectively reduce the dynamic errors of machine tools. By improving the machine's dynamic performance and increasing TCP accuracy, these functions take milling to the limits of the technologically possible—regardless of the machine's age and load or machining position. No mechanical modifications are needed.

Attaining precise workpieces with high surface quality no longer requires working slowly. That's because, with Dynamic Precision, machine tools work fast and accurately at the same time.

High precision and fast machining are the basis for increased productivity. Unit cost is therefore reduced without sacrificing accuracy or surface quality. Dynamic Precision even ensures that accuracy is maintained regardless of the operating time and load. As a result, feed rates no longer need to be reduced on account of machine age or load.

The functions of Dynamic Precision are available as options for HEIDENHAIN controls. The machine manufacturer can deploy individual functions alone or in combination.

- CTC: compensation of accelerationdependent position error at the tool center point, thus increasing accuracy during acceleration phases
- MVC: damping of machine vibrations for improved surface finishes
- PAC: position-dependent adaptation of control parameters
- LAC: load-dependent adaptation of control parameters for high accuracy, regardless of machine age and load
- MAC: motion-dependent adaptation of control parameters

The functions of Dynamic Precision are adapted to the movements and loads of the machine tool through a high clock rate in the controller unit (a component of HEIDENHAIN controls).

Because Dynamic Precision is made up of software functions, it requires no intervention in the machine's mechanics or power train. Nevertheless, the machine manufacturer must enable the individual functions, enter their parameters, and adapt them to the machine.



TNC7 TNC7 basic	TNC 640	TNC 620	Page
✓	√	√	
Option	Option	Option	36
Option	Option	Option	40
Option	Option	Option	37
Option	Option	Option	38
Option	Option	Option	39
	TNC7 basic ✓ Option Option Option Option	TNC7 basic✓✓OptionOptionOptionOptionOptionOptionOptionOptionOptionOption	TNC7 basic✓✓OptionOptionOptionOptionOptionOptionOptionOptionOptionOptionOptionOptionOptionOption

For more information, see the *Dynamic Precision* Technical Information document, and visit *www.klartext-portal.com*

With the concept of Dynamic Efficiency, HEIDENHAIN combines innovative TNC functions that help the user to make heavy machining and roughing more efficient while also enhancing process reliability. These software functions not only assist the user but also make the manufacturing process itself faster, more stable, and more predictable—in short, more efficient. Dynamic Efficiency helps boost the metal removal rate and reduce machining time.


Dynamic Efficiency encompasses four software functions:

- ACC: reduces chatter susceptibility, thus permitting higher feed rates and greater infeeds
- AFC: controls the feed rate based on the machining situation
- Trochoidal milling: a function for toolfriendly roughing of slots and pockets
- OCM: optimizes roughing processes for fast and low-wear machining

The AFC, ACC, and OCM functions are described in greater detail later in this brochure and are identifiable by their Dynamic Efficiency logo.

Individually, each of these solutions delivers key improvements to the machining process. But in combination, these TNC functions bring out the full potential of the machine and tool while reducing the mechanical load. They are also of great value under changing machining conditions, such as during interrupted cuts, various plunging processes, or simple roughing operations. In practice, the removal rate can be increased by 20 to 25 percent.

By permitting higher removal rates, Dynamic Efficiency boosts productivity without requiring users to resort to special tools. The avoidance of tool overloading and premature tool wear, as well as the additional gain in process reliability, significantly contributes to more economical production.

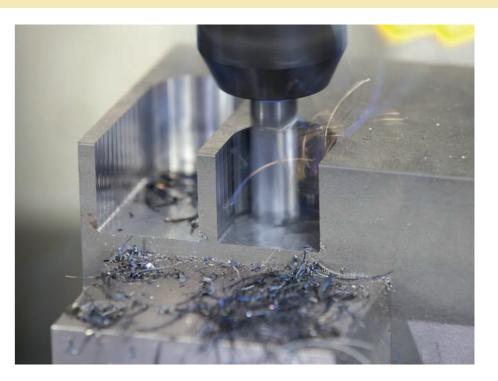

Dynamic Efficiency

Active Chatter Contr. Active chatter control

Adaptive Feed Contr. Adaptive feed control

Trochoidal milling

Opt. Contour Milling Optimized contour ma

Installation by the machine manufacturer or user

For more information, see the *Dynamic Efficiency* Technical Information document, and visit *www.klartext-portal.com*



	TNC7 TNC7 basic	TNC 640	TNC 620	Page
	\checkmark	✓	_	
: (ACC)	Option	Option	Option	48
r. (AFC)	Option	Option	-	47
	Standard function	Standard function	Standard function	-
(OCM) achining	Option	Option	Option	49
hing many facturer or	unar			

Connected Machining

Solutions for networked manufacturing

connected

machining

Digital Shop Floor

Software solutions for your manufacturing operations

With the Connected Machining package of functions, the HEIDENHAIN control streamlines operations thanks to easy data usage, time-saving workflows, and transparent processes. These solutions put the user at the center of digital job management through the control on his milling machine or lathe. The HEIDENHAIN control can be linked as desired to every production-related area of the company, featuring adaptability to already existing structures and extensibility for future innovation.

The benefits are time-saving workflows, workload reduction through easy data usage, and transparent processes in all areas of the company—not just on the shopfloor but also in design, production planning, management, logistics, servicing, and more. Purely digital job management with Connected Machining augments the strong manufacturing capabilities of modern equipment and machines.

Efficient and lossless data transmission

Use the TNC control to directly access data in your network or to transfer data from your PC to the TNC control. The program manager makes access to network drives quick and easy. The SFTP share directly in the Explorer of your PC offers secure access to local drives of the TNC controls.

Supported file formats

Being able to display, edit and evaluate common file types opens up many possibilities for using digital job data directly on the control. The Extended Workspace display provides a clear representation of your job data without losing track of important information about the control.

- PDF viewer for displaying task lists and
- manufacturing notes, for example (*.pdf) • CAD viewer for displaying 3D models and design drawings, for example (*.step, *.stl, *.dxf, *.iges)
- Graphics files for displaying clamping situations, for example (*.gif, *.bmp, *.ipg, *.png)
- Spreadsheets for displaying working steps and tool data, for example (*.xls, *.xlsx, *.ods)
- HTML viewer for displaying documentation and help files, for example (*.htm, *.html, *.chm)

Remote operation

The following functions are available for remote operation of HEIDENHAIN controls or third-party CNC controls:

- HEIDENHAIN OPC UA NC Server for cross-platform remote monitoring and controlling of a TNC. The task-oriented method of operation reduces the time required and allows interaction without in-depth knowledge about the control.
- HEIDENHAIN DNC (option) for monitoring and remote operation of machines, including older models.
- Remote Desktop Manager software option for access from the control to Windows PCs and the software installed there.
- · Firefox web browser for accessing webbased applications, such as ERP and MES clients, e-mail clients, and HTML5 applications.

The software solutions of the Digital Shop Floor from HEIDENHAIN are ideal for manufacturing companies that use CNC machine tools. They provide support along the process chain, ensuring improved process guality and enabling sustainable productivity gains.

StateMonitor

StateMonitor provides insight into the production processes of machine tools in real time. It collects and visualizes machine statuses, tool data, NC program durations and other machine-related data. This software solution allows you to document setup and production times, plan maintenance work and speed up your response time to malfunctions.



- OPC UA
- MTConnect
- Modbus TCP
- FOCAS



HEIDENHAIN

JobTerminal

and job analyses.

5 Signals records additional machine data via PLC signals.



	TNC7 TNC7 basic	TNC 640	TNC 620	Page
Connected Machining	~	✓	✓	
Remote Desk. Manager	Option	Option	Option	55
HEIDENHAIN DNC	Option	Option	Option	54
OPC UA NC Server	Option	Option	Option	53
Extended Workspace	Option	Option	-	81
Installation by the machine manufacturer				

For more information, see the TNC brochures





Software options for use with StateMonitor


JobTerminal manages job data, job times

HEIDENHAIN MaintenanceManager

MaintenanceManager displays maintenance and malfunction messages. Maintenance work can be planned based on machining hours, machine messages and intervals of time.





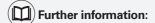

Find out more about StateMonitor under Software (page 66).

Machining with a rotary table

Many five-axis operations that initially seem very complex can actually be reduced to conventional 2D movements executed on a cylindrical surface. For creating and editing these programs quickly and easily without a CAM system, the TNC comes to your aid with helpful functions.

Cylinder surface machining


With the TNC it is guite easy to program contours (which consist of straight lines and arcs) on cylindrical surfaces using rotary and tilting tables: You simply program the contour in a plane (regardless of the axes) as if the cylinder surface were unrolled. The TNC then executes the programmed machining operation on the cylinder surface.


The TNC provides four cycles for cylinder surface machining:

- Slot milling (the slot width and tool diameter are equivalent)
- Guide-groove milling (the slot width is greater than the tool diameter)
- Ridge milling
- Outside contour milling

Feed rate for rotary axes and tables in mm/min

By default, rotary axis feed rates are programmed in degrees/min, but the TNC can also interpret these feed rates in mm/min. This makes the feed rate at the contour independent of the distance between the tool center point and the center of the rotary axis.

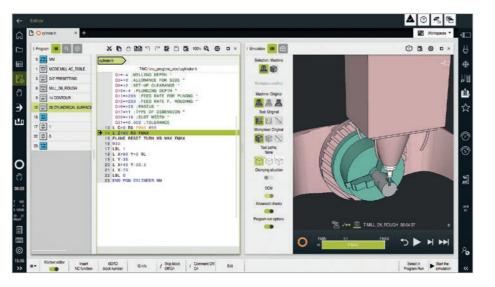

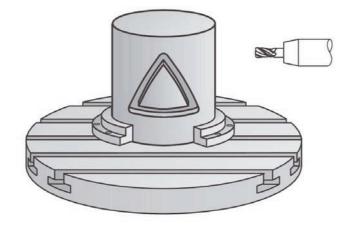

Adv. Function Set 1	SIK	SIK2
	Option 8	1-01-1
TNC7/TNC7 basic/TNC 640/TNC 620 TNC 320	ID 617920-01 ID 536146-01	ID 1395831-01
TNC7 TNC7 basic	NC SW 81762x-16 and NC SW 81762x-18 and	
TNC 640	NC SW 34059x-01 and	
TNC 620	,	98x-01/81760x-01 and late
TNC 320	NC SW 34055x-01/7718	35 I-UI and later

Installation by the machine manufacturer

For more information, see the TNC brochures

Programming and operation Coordinate conversion by tilting the working plane

and using the PLANE function

Programs for contours and holes on inclined surfaces are usually very complex, requiring significant computing resources and programming work. In cases like these, the TNC can save you a great deal of programming time. You simply program the machining operation as usual in the main plane (e.g., in XY). The machine then runs the program in a plane that has been tilted with respect to the main plane about one or more rotary axes.

The PLANE function makes it easy to define a tilted working plane and, based on the information in the workpiece drawing, offers seven different methods for doing so. In order to keep this complex function as easy to use as possible, each plane definition has its own animation that you can view prior to selecting the function. Intuitive help graphics assist you during programming.

You can also use the PLANE function to define the positioning behavior during tilting to avoid unpleasant surprises when the program is run. The settings for defining the positioning behavior are identical for all PLANE functions, making operation much easier.





Adv. Function Set 1

TNC7/TNC7 basic/TNC 6 TNC 320

TNC7
TNC7 basic
TNC 640
TNC 620
TNC 320

Installation by the machine manufacturer

For more information, see the TNC brochures, and visit www.klartext-portal.com

	SIK	SIK2
	Option 8	1-01-1
640/TNC 620	ID 617920-01 ID 536146-01	ID 1395831-01
	NC SW 81762x-16 and later NC SW 81762x-18 and later NC SW 34059x-01 and later NC SW 34056x-01/73498x-01/81760x-01 and later NC SW 34055x-01/771851-01 and later	
hing manufactur		

Touch probe cycles

Workpiece alignment

The probing functions of the TNC reduce the need for tedious manual alignment of the workpiece:

- Workpiece clamped in any position
- The touch probe determines the actual clamping situation by probing a surface
- The TNC compensates for this misalignment with a "basic rotation," either by rotating the NC program to the ascertained angle or by correcting the actual misalignment through a turn of the rotary table
- The TNC offers manual, automatic, and semiautomatic cycles for correcting misalignments in two or three dimensions
- Some automatic probing cycles feature semiautomatic mode, tolerance monitoring and actual-to-nominal value transfer
- Automatic probing cycle with which touch points in one direction can be repeated over a specified distance

Preset setting

Being able to define the preset quickly and reliably reduces nonproductive time and increases machining accuracy. The TNC features probing cycles for automatically setting presets.

Workpiece inspection


The TNC features numerous measuring cycles for inspecting the geometry of machined workpieces. This allows you to do the following:

- Identify a workpiece and call an appropriate part program
- Check for correct execution of all machining operations
- Detect and compensate for tool wear, etc.


Tool measurement


In conjunction with the TT touch probes for tool measurement, the TNC makes it possible to automatically measure tools inside the machine. The measured tool length and radius are stored by the TNC in its central tool memory. In-process tool measurement allows you to immediately identify wear or breakage, thus avoiding scrap and rework.

On the TNC 620, the touch probe cycles are available only with the **Touch Probe Functions** software option. This option is automatically enabled when using HEIDENHAIN touch probes featuring the EnDat interface (NC SW 81760x-06 and later). The TNC7, TNC 640 and TNC 320 already include the touch probe cycles as standard functions.

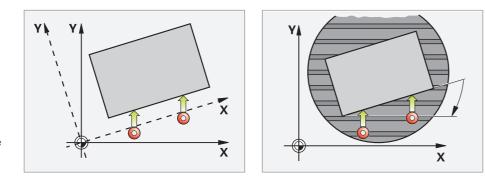


Compensating for workpiece misalignment by rotating the coordinate system or rotating the table

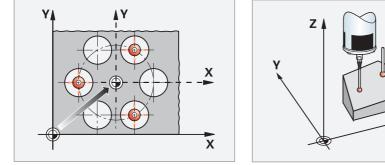


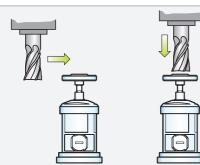

Tool measurement

Preset setting

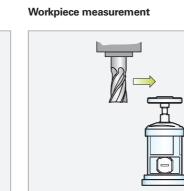


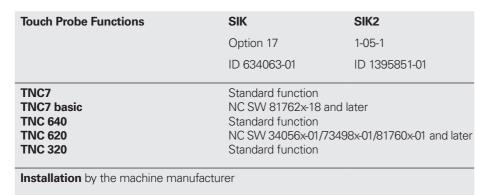

For more information, see the TNC brochures and the Touch Probes brochure

Programming and operation Graphical 6D workpiece setup

For single parts and small lot sizes without a special holder, the position of the workpiece blank almost always needs to be ascertained before machining. With this intuitive probing function, the TNC7 and TNC7 basic offer the possibility of setting up workpieces quickly, easily and safely with graphic guidance. The exact position of the workpiece blank is measured in the machine's working space and reported to the control. This graphically supported measurement can be used for any workpieces. An accurate 3D model is all that is needed. You can simplify and clean up the 3D model of your workpiece using the CAD Model Optimizer software option, in order to create a valid STL file for the measurement procedure.

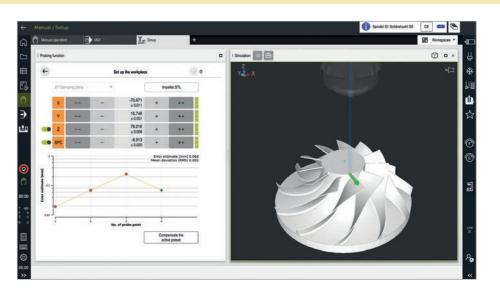

The simulation view depicts a 3D model of the workpiece blank in the machine's working space. After the user has roughly aligned the model manually, a green arrow indicates that the model is ready to be probed. The axis keys or the electronic handwheel are used to position the touch probe to the blank in order to record the touch points. The control automatically selects the probing direction. All of the six degrees of freedom can thus be measured with only one single function.

During the entire setup process, the control informs the user about the quality of the probing points for determining the position and orientation of the workpiece. The user can thus guickly see when the measurement of the actual position and orientation of the workpiece is complete. The user can also move the rotary axes during the setup procedure in order to probe undercuts, inclined surfaces, or rounded surfaces, for example. This allows the user to align even complex workpiece blanks relative to pre-machined features, such as is needed for mold repair or 3D-printed workpiece blanks.

Model Aided Setup

TNC7 **TNC7** basic **TNC 640 TNC 620 TNC 320**

Installation by the user

For more information, see the TNC7 brochure, and visit www.klartext-portal.com

SIK	SIK2
Option 159	1-07-1
ID 1364052-01	ID 1395855-01
NC SW 81762x-17 and NC SW 81762x-18 and - - -	

Advanced programming functions, including FK free contour programming and canned cycles

FK free contour programming

Not all workpieces are suitably dimensioned for conventional NC programming. Thanks to the FK free contour programming function you simply enter data from the drawing without performing additional conversions or calculations. In the process, you can leave individual contour elements undefined as long as the overall contour is defined. If the data allow for more than one solution, then the TNC programming graphics render the possible variants to choose from. On the TNC7 and TNC7 basic, graphical programming replaces FK programming as a standard feature.

Standard cycles

In addition to the canned cycles for drilling and tapping (with or without a floating tap holder), the **Advanced Programming** Features software option also gives you cycles for thread milling, reaming, boring, and hole patterns, as well as milling cycles for plane-surface face milling and for roughing and finishing pockets, slots, and studs.

Cycles for complex contours

Special help for roughing pockets with any contour is provided by the Subcontour List (SL) cycles and the **Optimized Contour** Milling software option. These groups of cycles each contain canned cycles for roughing and finishing. The contour or subcontours are defined in subprograms. As a result, a single contour description can be used for various operations with different tools.


OEM cycles


As original equipment manufacturers, machine manufacturers can contribute their special manufacturing know-how by designing additional fixed cycles and saving them in the TNC. The end user is likewise given the option of programming his own cycles. HEIDENHAIN supports you with its PC software CycleDesign, which allows you to create input parameters and arrange the menu key structure of the cycles as desired.

Graphical contour programming*

Couple the familiar Klartext functions with the graphical programming capability to streamline your daily work at the machine. With the graphical programming feature, the user draws the desired contours directly on the touchscreen. The control then converts the drawing into a Klartext program. This function makes it very easy to modify existing programs.

* Available only for TNC7 and TNC7 basic

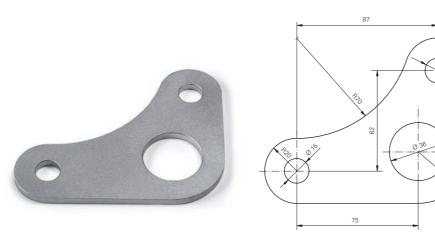

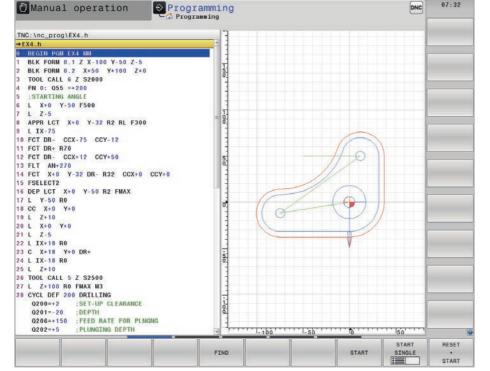

Programming graphics of the TNC 640

Advanced Programming Features	SIK
	Option 19
	ID 628252-01
TNC7 TNC7 basic TNC 640 TNC 620 TNC 320	Standard function Standard function Standard function NC SW 34056x-01/73498x-01/81760x-01 and later Standard function
Installation by the user	

For more information, see the TNC brochures, and visit www.klartext-portal.com

Programming and operation

Verification graphics, program-run graphics

Programming graphics

HEIDENHAIN controls support you with detailed programming graphics. These graphics are a feature on the TNC 640, TNC 620 and TNC 320, and are described in their respective brochures.

Other graphical views are available as options:

Simulation

To be on the safe side before running a program, the TNC can graphically simulate the machining operation. The TNC can display this simulation in the following ways:

- In plan view with different shades of depth
- In different projections (as in the workpiece drawing)
- In 3D view

Details can be shown under magnification. In addition, the TNC displays the calculated machining time in hours, minutes, and seconds. During the simulation, the TNC7, TNC7 basic, TNC 640 and TNC 620 controls can also detect collisions between the workpiece and the tool holder, and can issue appropriate warning messages.

Model comparison

The TNC7 and TNC7 basic have a feature for comparing the workpiece blank and the finished part. Based on the different colors, you easily see where residual material still remains or where too much material was removed. There is also a measuring function that lets you ascertain the position and depth at any location on the workpiece, together with the current NC block and the associated tool.

Program-run graphics

Direct observation of the workpiece within the machine is usually impossible due to coolant and the safety enclosure. With the program-run graphics vou can always see the current machining status of the workpiece as well as the positions of the collision objects in the machine on the control's screen. During machining, you can switch between various operating modes at any time, for example in order to create programs.



Simulation of machining on the TNC7



Program-run graphics of the TNC7

Advanced Graphic Fea

TNC7 **TNC7** basic **TNC 640 TNC 620 TNC 320**

Installation by the user

SIK
Option 20
ID 628253-01
Standard function Standard function Standard function NC SW 34056x-01/73498x-01/81760x-01 and later Standard function

For more information, see the TNC brochures, and visit www.klartext-portal.com

Detailed 3D view in the verification and program-run graphics

Programming and operation

Pallet management

For any sequence of different workpieces

loaded on pallets, the TNC is able to

and datum shift.

in any order desired.

identify the proper machining program

axes. The desired sequence and presets

for the pallet and workpieces are defined

in the pallet table by the user. The pallet

manufacturer, which means that any

and called later by the PLC.

and later on the TNC 620).

information can be stored in the tables

Execution of the pallet tables with the

control can be either workpiece- or tool-

on the TNC 640; with NC SW 81760x-05

Finely detailed 3D view

The simulation and program-run graphics of the controls also include additional viewing functions with detailed 3D rendering. These functions help you evaluate the workpiece quality in the simulation prior to machining, as well as in real time during machining.

The high-resolution 3D view with strong zoom factors reveals even the tiniest program errors on the workpiece surface. For an even more precise view of the NC data analysis, you can also display the tool paths and their corresponding block numbers. Of particular help is the selectable workpiece transparency feature, which allows you to see hidden cavities and undercuts. The TNC7 and TNC7 basic offer a sectional view along a plane. This is useful, for example, when looking for residual material.

Enhanced graphics also make tool-specific machining operations easier to see: each machining operation performed with the same tool is shown in its own unique color. In 3D view, the TNC also includes a measuring function that displays the coordinates when you shift the focus within the graphics by touch.

If you just need a quick overview of the contour and the machining time, you can change the resolution and simulation mode to boost the calculation speed.

The TNC 640 (with NC SW 34059x-09 and later), the TNC7 and the TNC7 basic simulate not only material removal but also the complete 3D machine model, allowing the user to precisely evaluate processes in the working space before machining. The machine's collision objects are configured and activated by the machine manufacturer.


The TNC7 and TNC7 basic. TNC 640 (with NC SW 34059x-11 and later) and TNC 620 (with NC SW 81760x-08 and later) enable the convenient incorporation of complex workpiece blanks and finished parts as STL files (such as 3D models from CAM systems). In addition, the current machining status can be saved as an STL file during the simulation in order to integrate it into other programs as a workpiece blank.



Installation by the user

For more information, see the TNC brochures, and visit www.klartext-portal.com

Manual operation Test Run YZ X 00:14:51 F MAX VIEW -RESET SINGLE OPTIONS OFF ON OFF ON

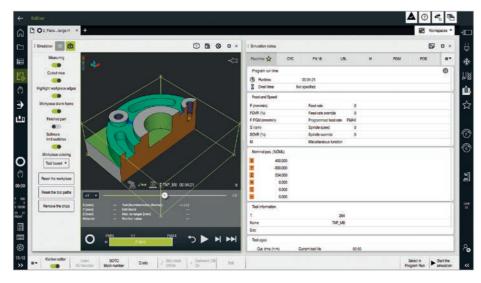



Pallet Managemen
TNC7

TNC7 basic **TNC 640 TNC 620 TNC 320**

Installation by the machine manufacturer

For more information, see the TNC brochures, and visit www.klartext-portal.com

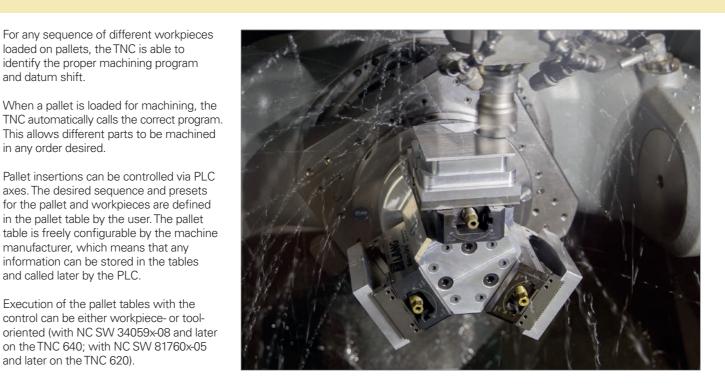

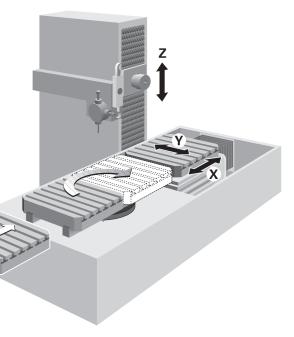

SIK

Option 22 ID 628255-01

Standard function Standard function Standard function Standard function

Programming and operation Batch Process Manager for organizing and fine tuning of job sequences on the machine

Batch Process Manager is a powerful function for pallet machining and series production. With its intuitive user interface, you can plan your production process and receive important information about upcoming machining operations.

Batch Process Manager makes it possible to easily change the sequence of pending jobs. Batch Process Manager also performs a duration calculation for all planned jobs or NC programs. It checks whether, for example, all NC programs will be able to run without error and whether all necessary tools are available with sufficient remaining service life. Batch Process Manager displays the results of these checks in the status overview, thereby ensuring the smooth execution of the planned jobs.

Batch Process Manager shows the following information in advance:

- The machining sequence
- The time of the next manual intervention • Program duration and end time of
- program run Status information about preset, tool, and program

On the TNC 620, Batch Process Manager requires the additional enabling of the Pallet Management software option. On controls with NC software versions up to 34059x-08 or 81760x-05, the **Extended** Tool Management software option must be enabled as well.

Necessary manual interventions		Object Time			Next manual intervention:			
External tool Fixture not machinable External tool	TORUS_MILL_ NC_SPOT_DRII			08:56		1	16m 34s	XYZ.
Program	Duration	End	Preset	т	Pgm	Sts	Pallet	+
→ 🗖 Pallet: 1	32m 38s		۵ 🔔				Name	
1_Prisma_prism.h	16m 20s	08:39	4	1	1	占	1	XYZ
2_Haus_house.h	16m 18s	08:56	1	×	1	4	Datum table	-
😽 Aufspannung:	0s		*		0		Preset	
🗆 Palette: 2	16m 20s		1	1	4		5	n
3_Seitenbearb_e_machining.h	05		\$			-	Locked	OFF
4_Taschen_pocket.h	16m 20s	09:12	@1	1	1	4	Machinable	_
🗆 Palette: 3	3m 21s		9 1		×		X	_
5_Winkelstueck_bend.h	3m 21s	09:15	4	4	4	-		
7_Flansch_flange.h	0s		1		×	4		
1	00% F-0	OVR		S	T : 2	2	1	
	40% F-N	MAX S	1	L	IMI	Т	1	
1 X +324	. 025 A		+9	90.	000	0 S	1 +233.000	
Y - 193	.612 C		+31	10.	000	0		
*3 🖉 🌮 🔽 +1244	784	-						
Modus: ACTL, 33 T 2	ZSS	000	F Omm	/m in		0	r 100% M 5/9	8

Programming and operation CAD import for contours and machining positions from DXF files

Why program contours when you already have the drawing as a DXF file? You can open DXF files directly on the TNC in order to extract contours or machining positions from them. This not only saves time otherwise spent on programming and testing but also provides assurance that the finished contour precisely complies with the design engineer's specifications.

DXF files usually contain multiple layers used by the design engineer to organize the drawing. In order to minimize unneeded information on your screen during contour selection, you can hide all of the inessential layers in the DXF file with just a gesture. This feature requires an operating panel with a touchpad or an external pointing device. The TNC can select a contour train even if it has been stored across different layers.

The TNC also assists you in defining the workpiece preset. For this purpose, the TNC provides a function that allows you to move the drawing's datum to a useful position by simply selecting an element. Selecting contours is also very convenient: you can select any element by touch. As soon as you select a second element, the TNC detects your desired direction of machining, and starts automatic contour detection. The TNC automatically selects all clearly identifiable contour elements until the contour closes or branches out. At that point, you can select the next contour element. In this way you can quickly and easily define even extensive contours by touch. You can also shorten, lengthen, or interrupt the contour elements as needed.

In addition, you can easily select machining positions and save them as point files, especially for transferring drilling positions or starting points for pocket machining. Of course, the TNC saves the machining positions in such a way that they are approached via the shortest path.

With the CAD Import software option, you can also import contours and machining positions from 3D models.

CAD Import

- = 0

TAL MILL DIE ROUGH

Inset NC function

Positions Mill.

Onto


TNC7
TNC7 basic
TNC 640
TNC 620
TNC 320

Installation by the user

For	more	information,
101	more	monutation,

Batch Process Mngr.	SIK	SIK2
	Option 154	2-05-1
	ID 1219521-01	ID 1395860-01
TNC7	NC SW 81762x-16 and	later
TNC7 basic	NC SW 81762x-18 and	later
TNC 640	NC SW 34059x-08 and	later
TNC 620	NC SW 81760x-05 and	later
TNC 320	-	
Installation by the machine manufacturer		

For more information, see the TNC brochures, and visit www.klartext-portal.com

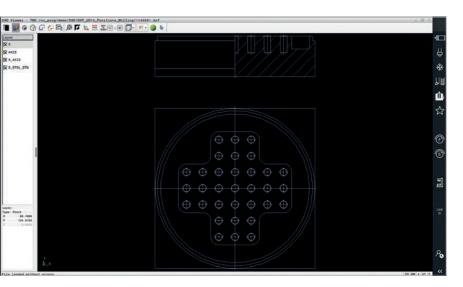



	SIK	SIK2
	Option 42	1-03-1
	ID 526450-01	ID 1395847-01
	NC SW 81762x-16 and l NC SW 81762x-18 and l NC SW 34059x-02 and NC SW 73498x-02/8176 NC SW 771851-01 and l	ater later 60x-01 and later
r		

see the TNC brochures, and visit www.klartext-portal.com

Programming and operation CAD import for contours from 3D models

Programming and operation Optimization of CAD models


CAD Viewer enables the display of 2D and 3D models right on the TNC (e.g., DXF, Step, STL or IGES files). Using the CAD Import software option, you can easily incorporate contours and machining positions from these CAD files directly into your Klartext program. You can thereby reduce the amount of programming work and avoid input errors resulting from transposed digits, incorrectly placed decimal points, and the like.

In particular, extracting machining information directly from CAD data provides additional possibilities for creating NC programs with a tilted working plane. You can also define the preset with a 3D basic rotation of the 3D model and set a datum with the appropriate 3D rotation in the desired working plane.

You can easily save the working plane to the clipboard and transfer it to the NC program with the appropriate transformation and the associated PLANE command. In the defined working plane, you can extract contours and machining positions, and apply them to the NC program.

Selecting contours is very convenient: you can select any element by clicking it with the mouse. Once you select a second element, the TNC detects your desired machining direction and initiates automatic contour detection. In doing so, the TNC automatically selects all clearly identifiable contour elements until the contour closes or branches out. This method lets you define elaborate contours with just a few clicks of the mouse. You can then easily copy the selected contour via the clipboard to an existing Klartext program.

The CAD Import software option is an expansion to the DXF Converter. All previous functions have been adopted and enhanced to include 3D import functions. Nearly all of the common DXF, Step and IGES file formats can be used.

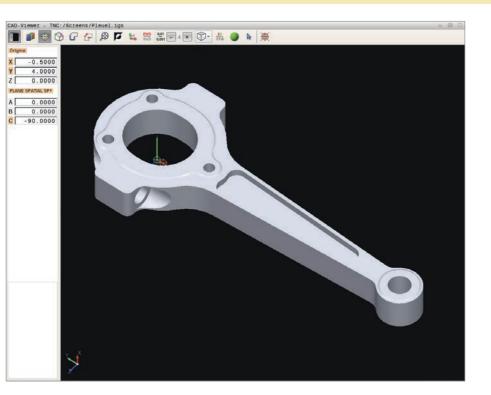


SIK2 **CAD** Import SIK Option 42 1-03-1 ID 526450-01 ID 1395847-01 TNC7 NC SW 81762x-16 and later **TNC7** basic NC SW 81762x-18 and later **TNC 640** NC SW 34059x-08 and later **TNC 620** NC SW 81760x-05 and later **TNC 320** NC SW 771851-05 and later Installation by the user

For more information, see the TNC brochures, and visit www.klartext-portal.com

The **CAD Model Optimizer** software

option offers the user the power to simplify 3D models and heal contours, thus creating valid STL files for collision monitoring or simulation.

The initial model can be imported through CAD Viewer. The 3D mesh function simplifies the model and autonomously corrects errors such as small holes in the solid model or self-intersecting lines on surfaces. The control covers the opened 3D model with a mesh of triangles. The control then generates an STL file that you can use for various functions of the control. For example, you can then quickly and easily repair faulty files of fixtures or tool holders.

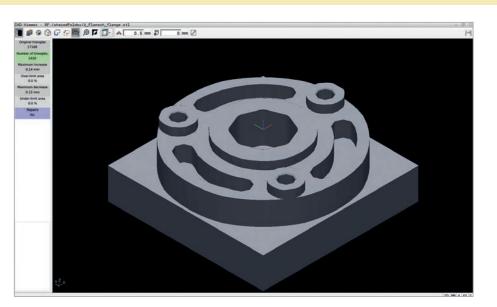

With this software option you can also adapt 3D models of your fixtures before setting them up. The **Collision Monitoring v2** software option serves to monitor fixtures in the working space of your machine, thereby preventing collisions.

With the **CAD Model Optimizer** software option you can also correct small errors in the workpiece model before setting up the part using the 6D capability of the Model Aided Setup function.

CAD Model Optimizer

TNC7
TNC7 basic
TNC 640
TNC 620
TNC 320

Installation by the user

For more information, see the TNC brochures, and visit www.klartext-portal.com

SI	Κ

Option 152 ID 1353918-01

SIK2

1-04-1 ID 1395849-01

NC SW 81762x-16 and later NC SW 81762x-18 and later NC SW 34059x-16 and later NC SW 81760x-16 and later

Mill-turning functions for milling and turning on the same machine

Programming and operation

Mill-turning functions for eccentric turning

The control provides powerful functions for NC-program-driven switching between turning mode and milling mode. You are completely free to decide how and when you wish to combine these two machining modes.

Machining simple contours

Various cycles are available for the longitudinal and transverse machining of simple contours. The area to be machined can also be inclined, thus requiring a plunging movement. Of course, the TNC7 and TNC 640 automatically take the angle of the turning tool into account.

Machining any contours

If the contours to be machined are complex and can no longer be defined with simple cycle parameters, you can still describe them using contour subprograms. This process is identical to the procedure used for SL cycles in milling, for which you use Cycle 14 to define the subprogram describing the finished contour. You can define the technology parameters in the respective turning cycle.

You use exactly the same Klartext functions for the contour description as you would for defining a milling contour. Turning-specific recess and undercut contour elements are also available, which you can insert between contour elements in the same manner as chamfers and rounding arcs. Besides radial and axis recesses, E, F, H, K, and U undercuts are available, as are thread undercuts. Depending on the cycle, the TNC7 and TNC 640 cut parallel to the axis or the contour. You define the machining operations (roughing, finishing) or the oversize with dialog guidance in the corresponding parameters.

Other machining operations:

- Recessing
- Thread machining
- Blank form update
- Orientation of the turning tool



Turning with a facing slide

-

A facing slide allows you to perform turning operations on a stationary workpiece. This, in turn, makes it possible to implement offcenter or tilted-plane turning operations. With a facing slide, the cutting edge rotates in the spindle, while an axis integrated in the facing slide controls the turning tool (plan stroke). With the TNC7 and TNC 640, you don't need to worry about the complex motion involved. You simply select the facing-slide mode with a programming command and program as always with standard turning cycles. The TNC7 and TNC 640 handle all the conversions for you and automatically perform all motion sequences.




Turning	SIK	SIK2	
	Option 50	4-03-1	
	ID 634608-01	ID 1395877-01	
TNC7	NC SW 81762x-16 and later		
TNC7 basic	-		
TNC 640	NC SW 34059x-01 and later		
TNC 620	-		
TNC 320	-		
Installation by the machine manufacturer			

For more information, see the TNC brochures, and visit www.klartext-portal.com

The eccentric turning function lets you perform turning operations even when the workpiece axis is misaligned with the axis of rotation due to the setup. During machining, the TNC7 and TNC 640 then compensate for any eccentricity through corrective movements of the rotary spindle coupled with the linear axis. This can significantly reduce your setup times.

* On controls with NC software version 34059x-04, the Synchronizing Functions software option must be enabled.

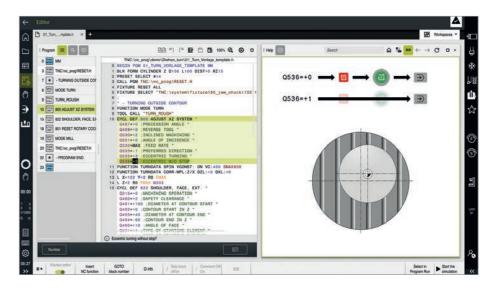

Turning

TNC7 TNC7 basic **TNC 640 TNC 620 TNC 320**

Installation by the machine manufacturer

	SIK	SIK2
	Option 50	4-03-1
	ID 634608-01	ID 1395877-01
	NC SW 81762x-16 and I	ater
	-	
	NC SW 34059x-04 and	later
	-	
	-	
hine menufacture		

For more information, see the TNC brochures, and visit www.klartext-portal.com

Programming and operation Mill-turning functions for simultaneous turning

Programming and operation Extended tool management

This software option allows you to produce complex contours that would otherwise require machining at varying tool angles. This way you can, for example, produce undercut contours with just one tool. For simple contours, this option can prolong tool life by using a larger area of the indexable insert. This involves at least three-axis motion (two linear axes and one rotary axis).

The cycles for simultaneous turning monitor the workpiece contour relative to the tool and the tool carrier. To attain optimal surface finishes, these cycles avoid unnecessary tilting movements. If you wish to activate specific tilting movements, you can define start and finish angles on the TNC7 and TNC 640. A cycle for simultaneous roughing is also available (with NC software version 11 and later).

The control now permits the use of FreeTurn tools for inclined and simultaneous turning operations. FreeTurn tools are lathe tools with a special tooth arrangement. Depending on the design, a single FreeTurn tool can perform both axis-parallel and contour-parallel roughing and finishing. The use of FreeTurn tools reduces machining times because fewer tool changes are needed (with NC software version 16 and later).



The Extended Tool Management

software option expands tool management functionality with the "Tooling list" and "T usage order" tables. The "Tooling list" table shows the tool requirements of the NC program or pallet to be run. The "Tooling list" table contains information about all the tools called within an NC program. Before starting the program, you can check, for example, whether all tools are contained in the magazine. When you select an NC program in the Program Run operating mode, the control automatically creates the "Tooling list" table. The control lists all the tools called within the active NC program in numerical order.

6 5 DRILL_D5 OK "ORILL_D5" 39 15:38:29.000 12:10.2022 7 203 NC_SPOT_DRILL_D10 Not Tound "NC_SPOT_DRILL_D10 17 15:39:25.000 12:10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:25.000 12:10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:54.000 12:10.2022 10 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:40:33.000 12:10.2022 11 263 TAP_M6 Not found "NC_SPOT_DRILL_D10 17 15:40:50.000 12:10.2022 12 5 DRILL_D5 OK "DRILL_D5" 39 15:41:19.000 12:10.2022 13 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:41:158.000 12:10.2022 14 263 TAP_M6 Not found "TAP_M6" 29 15:42:15.000 12:10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39	0 5 DRILL_D5 0K 'DRILL_D5'' 39 15:35:39.000 12:10:2022 1 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:36:18.000 12:10:2022 2 283 TAP_M6 Not found "TAP_M6" 29 15:33:30.000 12:10:2022 4 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:37:44.000 12:10:2022 5 263 TAP_M6 Not found "NC_SPOT_DRILL_D10 17 15:37:44.000 12:10:2022 6 5 DRILL_D5 OK "DRILL_D5" 39 15:38:29.000 12:10:2022 7 203 NC_SPOT_DRILL_D10 Not found "TAP_M6" 29 15:38:29.000 12:10:2022 8 263 TAP_M6 Not found "TAP_M6" 29 15:39:25.000 12:10:2022 9 5 DRILL_D5 OK "DRILL_D10 17 15:40:33.000 12:10:2022 10 203 NC_SPOT_DRILL_D10 Not found "TAP_M6" 29 15:40:30.000 12:10:2022 </th <th>DIS PO</th> <th>ckets Tooling list T us</th> <th></th> <th></th> <th></th> <th></th> <th></th>	DIS PO	ckets Tooling list T us					
1 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:36:16.000 12.10.2022 2 263 TAP_M6 Not found "TAP_M6" 29 15:36:35.000 12.10.2022 3 5 DRILL_D5 OK "DRILL_D10 17 15:37:43.000 12.10.2022 4 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:37:43.000 12.10.2022 5 263 TAP_M6 Not found "NC_SPOT_DRILL_D10 17 15:38:29.000 12.10.2022 6 5 DRILL_D5 OK "DRILL_D5" 39 15:38:29.000 12.10.2022 7 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:39:25.000 12.10.2022 7 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:39:25.000 12.10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:25.000 12.10.2022 10 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:40:30.000 12.10.2022 11 263 TAP_M6 Not found "NC_SPOT_DRILL_D10 17 15:40:50.000 12.10.2022 13 203 NC_SPOT_DRILL_D10	1 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:36:18,000 12:10.2022 2 263 TAP_M6 Not found "TAP_M6" 29 15:37:43,000 12:10.2022 3 5 DRILL_D5 OK "ORIL_D10" 17 15:37:43,000 12:10.2022 4 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:37:43,000 12:10.2022 5 263 TAP_M6 Not found "NC_SPOT_DRILL_D10 17 15:38:00,000 12:10.2022 6 5 DRILL_D5 OK "DRILL_D5" 39 15:38:29,000 12:10.2022 7 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:38:29,000 12:10.2022 7 203 NC_SPOT_DRILL_D10 Not found "AC_SPOT_DRILL_D10 17 15:39:26,000 12:10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:26,000 12:10.2022 10 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:40:30,000 12:10.2022 11 263 TAP_M6 Not found "TAP_M6" 29 15:40:50,000 12:10.2022 13 203 NC_SPOT_DRILL_D10 Not found<	_	NAME		T PROG	USAGE	TOOL TIME	÷
2 263 TAP_M6 Not Tound "TAP_M6" 29 15:38:35.000 12.10.2022 3 5 DRILL_D5 OK "DRILL_D5" 39 15:37:04.000 12.10.2022 4 203 NG_SPOT_DRILL_D10 Not Tound "NG_SPOT_DRILL_D10 17 15:37:34.000 12.10.2022 5 263 TAP_M6 Not Tound "TAP_M6" 29 15:38:00.000 12.10.2022 6 5 DRILL_D5 OK "DRILL_D5" 39 15:38:29.000 12.10.2022 7 203 NC_SPOT_DRILL_D10 Not Tound "TAP_M6" 29 15:38:25.000 12.10.2022 7 203 NC_SPOT_DRILL_D10 Not Tound "TAP_M6" 29 15:39:25.000 12.10.2022 8 263 TAP_M6 Not Tound "TAP_M6" 39 15:39:26.000 12.10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:40:00.000 12.10.2022 10 203 NC_SPOT_DRILL_D10 Not Tound "TAP_M6" 29 15:40:00.000 12.10.2022 11 263 TAP_M6 Not Tound "TAP_M6" 29 15:41:19.000 12.10.2022 13 203 NC_SPOT_DRILL_D10 Not Tound "TAP_M6" 29 15:4	2 263 TAP_M6 Not Tound "TAP_M6" 29 15:38:35.000 12.10.2022 3 5 DRILL_D5 OK "DRILL_D3" 39 15:37:04.000 12.10.2022 4 203 NG_SPOT_DRIL_D10 Not Tound "NG_SPOT_DRILL_D10 17 15:37:34.000 12.10.2022 5 263 TAP_M6 Not Tound "NAP_M6" 29 15:38:00.000 12.10.2022 7 203 NC_SPOT_DRILL_D10 Not Tound "NC_SPOT_DRILL_D10 17 15:38:29.000 12.10.2022 7 203 NC_SPOT_DRILL_D10 Not Tound "NC_SPOT_DRILL_D10 17 15:39:25.000 12.10.2022 8 263 TAP_M6 Not Tound "NC_SPOT_DRILL_D10 17 15:39:25.000 12.10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:26.000 12.10.2022 10 203 NC_SPOT_DRILL_D10 Not Tound "NC_SPOT_DRILL_D10 17 15:40:30.000 12.10.2022 11 263 TAP_M6 Not Tound "NC_SPOT_DRILL_D10 17 15:40:50.000 12.10.2022 12 5 DRILL_D5 OK "DRILL_D5" 39 15:41:19.000 12.10.2022 13 203 NC_SPOT_DRILL_D10 Not Tound	-	5 DRILL_D5	■ ок	-		15:35:39,000 12.10.2022	S
3 5 DRILL_D5 OK "DRILL_D5" 39 15:37:04.000 12.10.2022 4 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:37:43.000 12.10.2022 5 263 TAP_M6 Not found "TAP_M6" 29 15:38:20.000 12.10.2022 7 203 NC_SPOT_DRILL_D10 Not found "TAP_M6" 39 15:38:25.000 12.10.2022 9 5 DRILL_D5 OK "DRILL_D10 17 15:38:25.000 12.10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:38:25.000 12.10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:54.000 12.10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:40:35.000 12.10.2022 11 263 TAP_M6 Not found "TAP_M6" 29 15:40:30.000 12.10.2022 13 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:41:58.000 12.10.2022 14 <td>3 5 DRILL_D5 OK "DRILL_D5" 39 15:37:04.000 12:10.2022 4 203 NC_SPOT_DRILL_D10 Not Tound "TAP_M6" 29 15:38:00.000 12:10.2022 5 263 TAP_M6 Not Tound "TAP_M6" 29 15:38:00.000 12:10.2022 7 203 NC_SPOT_DRILL_D10 Not Tound "TAP_M6" 29 15:38:25.000 12:10.2022 9 5 DRILL_D5 OK "ORTILL_D10 17 15:38:25.000 12:10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:38:25.000 12:10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:54.000 12:10.2022 10 203 NC_SPOT_DRILL_D10 17 15:40:350.000 12:10.2022 11 263 TAP_M6 NC "DRILL_D5" 39 15:41:19.000 12:10.2022 13 203 NC_SPOT_DRILL_D10 "TAP_M6"<td>1</td><td>203 NC_SPOT_DRILL_D10</td><td>Not found</td><td>"NC_SPOT_DRILL_D10</td><td>17</td><td>15:36:18,000 12.10.2022</td><td>4</td></td>	3 5 DRILL_D5 OK "DRILL_D5" 39 15:37:04.000 12:10.2022 4 203 NC_SPOT_DRILL_D10 Not Tound "TAP_M6" 29 15:38:00.000 12:10.2022 5 263 TAP_M6 Not Tound "TAP_M6" 29 15:38:00.000 12:10.2022 7 203 NC_SPOT_DRILL_D10 Not Tound "TAP_M6" 29 15:38:25.000 12:10.2022 9 5 DRILL_D5 OK "ORTILL_D10 17 15:38:25.000 12:10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:38:25.000 12:10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:54.000 12:10.2022 10 203 NC_SPOT_DRILL_D10 17 15:40:350.000 12:10.2022 11 263 TAP_M6 NC "DRILL_D5" 39 15:41:19.000 12:10.2022 13 203 NC_SPOT_DRILL_D10 "TAP_M6" <td>1</td> <td>203 NC_SPOT_DRILL_D10</td> <td>Not found</td> <td>"NC_SPOT_DRILL_D10</td> <td>17</td> <td>15:36:18,000 12.10.2022</td> <td>4</td>	1	203 NC_SPOT_DRILL_D10	Not found	"NC_SPOT_DRILL_D10	17	15:36:18,000 12.10.2022	4
4 203 NC_SPOT_DRILL_D10 Not Tound "NC_SPOT_DRILL_D10 17 15:37:43.000 12.10.2022 5 263 TAP_M6 Not Tound "TAP_M6" 29 15:38:29.000 12.10.2022 6 5 DRILL_D5 OK DRILL_D5" 39 15:38:29.000 12.10.2022 7 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:39:58.000 12.10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:55.000 12.10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:55.000 12.10.2022 10 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:40:33.000 12.10.2022 11 263 TAP_M6 Not found "NC_SPOT_DRILL_D10 17 15:40:30.000 12.10.2022 12 5 DRILL_D5 OK "DRILL_D5" 39 15:41:19.000 12.10.2022 13 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:41:19.000 12.10.2022 14 263 TAP_M6 Not found "TAP_M6" 29 <	4 203 NC_SPOT_DRILL_D10 Not Tound "NC_SPOT_DRILL_D10 17 15:37:43.000 12.10.2022 5 263 TAP_M6 Not Tound "TAP_M6" 29 15:38:29.000 12.10.2022 6 5 DRILL_D5 OK DRILL_D5" 39 15:38:29.000 12.10.2022 7 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:39:25.000 12.10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:25.000 12.10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:25.000 12.10.2022 10 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:40:33.000 12.10.2022 11 263 TAP_M6 Not found "NC_SPOT_DRILL_D10 17 15:40:30.000 12.10.2022 12 5 DRILL_D5 OK "DRILL_D5" 39 15:41:19.000 12.10.2022 13 203 NC_SPOT_DRILL_D10 Not found "TAP_M6" 29 15:42:15.000 12.10.2022 14 263 TAP_M6 Not found "TAP_M6" 29 15:42:1	2	263 TAP_M6	Not found	"TAP_M6"	29	15:36:35,000 12.10.2022	-
6 5 DRILL_D5 0K "DRILL_D5" 39 15:38:29.000 12:10.2022 7 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:39:25.000 12:10.2022 9 5 DRILL_D5 0K "DRILL_D5" 39 15:39:25.000 12:10.2022 9 5 DRILL_D5 0K "DRILL_D5" 39 15:39:25.000 12:10.2022 9 5 DRILL_D5 0K "DRILL_D5" 39 15:39:25.000 12:10.2022 10 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:40:33.000 12:10.2022 11 263 TAP_M6 Not found "NC_SPOT_DRILL_D10 17 15:40:50.000 12:10.2022 13 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:41:58.000 12:10.2022 14 263 TAP_M6 Not found "NC_SPOT_DRILL_D10 17 15:42:15.000 12:10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12:10.2022	6 5 DRILL_D5 0K "DRILL_D5" 39 15:38:29.000 12:10.2022 7 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:39:25.000 12:10.2022 9 5 DRILL_D5 0K "DRILL_D5" 39 15:39:25.000 12:10.2022 9 5 DRILL_D5 0K "DRILL_D5" 39 15:39:25.000 12:10.2022 9 5 DRILL_D5 0K "DRILL_D5" 39 15:39:25.000 12:10.2022 10 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:40:30.000 12:10.2022 11 263 TAP_M6 Not found "NC_SPOT_DRILL_D10 17 15:40:50.000 12:10.2022 13 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:41:58.000 12:10.2022 14 263 TAP_M6 Not found "NC_SPOT_DRILL_D10 17 15:42:15.000 12:10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12:10.2022	3	5 DRILL_D5	ОК	"DRILL_D5"	39	15:37:04.000 12.10.2022	
6 5 DRILL_D5 OK "DRILL_D5" 39 15:38:29.000 12:10.2022 7 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:39:26.000 12:10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:26.000 12:10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:26.000 12:10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:26.000 12:10.2022 10 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:40:33.000 12:10.2022 11 263 TAP_M6 Not found "NC_SPOT_DRILL_D10 17 15:40:50.000 12.10.2022 13 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:41:58.000 12.10.2022 14 263 TAP_M6 29 15:42:44.000 12.10.2022 15:001 15 5 DRILL_D5 OK </td <td>6 5 DRILL_D5 OK "DRILL_D5" 39 15:38:29.000 12:10.2022 7 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:39:25.000 12:10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:25.000 12:10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:25.000 12:10.2022 10 203 NC_SPOT_DRILL_D10 NOT found "TAP_M6" 29 15:40:00 12:10.2022 11 263 TAP_M6 Not found "NC_SPOT_DRILL_D10 17 15:40:33.000 12:10.2022 12 5 DRILL_D5 OK "DRILL_D5" 39 15:41:19.000 12.10.2022 13 203 NC_SPOT_DRILL_D10 NOT found "NC_SPOT_DRILL_D10 17 15:41:58.000 12.10.2022 14 263 TAP_M6 29 15:42:15.000 12.10.2022 51001 15 5 DRILL_D5 OK <t< td=""><td>4</td><td>203 NC_SPOT_DRILL_D10</td><td>Not found</td><td>"NC_SPOT_DRILL_D10</td><td>17</td><td>15:37:43,000 12.10.2022</td><td></td></t<></td>	6 5 DRILL_D5 OK "DRILL_D5" 39 15:38:29.000 12:10.2022 7 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:39:25.000 12:10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:25.000 12:10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:25.000 12:10.2022 10 203 NC_SPOT_DRILL_D10 NOT found "TAP_M6" 29 15:40:00 12:10.2022 11 263 TAP_M6 Not found "NC_SPOT_DRILL_D10 17 15:40:33.000 12:10.2022 12 5 DRILL_D5 OK "DRILL_D5" 39 15:41:19.000 12.10.2022 13 203 NC_SPOT_DRILL_D10 NOT found "NC_SPOT_DRILL_D10 17 15:41:58.000 12.10.2022 14 263 TAP_M6 29 15:42:15.000 12.10.2022 51001 15 5 DRILL_D5 OK <t< td=""><td>4</td><td>203 NC_SPOT_DRILL_D10</td><td>Not found</td><td>"NC_SPOT_DRILL_D10</td><td>17</td><td>15:37:43,000 12.10.2022</td><td></td></t<>	4	203 NC_SPOT_DRILL_D10	Not found	"NC_SPOT_DRILL_D10	17	15:37:43,000 12.10.2022	
7 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:39:25.000 12.10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:25.000 12.10.2022 10 203 NC_SPOT_DRILL_D10 NOT found "TAP_M6" 29 15:39:26.000 12.10.2022 11 263 TAP_M6 NOT found "TAP_M6" 29 15:40:33.000 12.10.2022 11 263 TAP_M6 NOT found "TAP_M6" 29 15:40:33.000 12.10.2022 12 5 DRILL_D5 OK "DRILL_D5" 39 15:41:19.000 12.10.2022 13 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:41:58.000 12.10.2022 14 263 TAP_M6 Not found "TAP_M6" 29 15:42:15.000 12.10.2022 14 263 TAP_M6 Not found "TAP_M6" 29 15:42:15.000 12.10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12.10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12.10.2022	7 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:39:08.000 12.10.2022 8 263 TAP_M6 Not found "TAP_M6" 29 15:39:25.000 12.10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:54.000 12.10.2022 10 203 NC_SPOT_DRILL_D10 Not found "TAP_M6" 29 15:40:33.000 12.10.2022 11 263 TAP_M6 Not found "TAP_M6" 29 15:40:30.000 12.10.2022 11 263 TAP_M6 Not found "TAP_M6" 29 15:40:30.000 12.10.2022 12 5 DRILL_D5 OK "DRILL_D5" 39 15:41:19.000 12.10.2022 13 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:41:58.000 12.10.2022 14 263 TAP_M6 Not found "TAP_M6" 29 15:42:15.000 12.10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12.10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12.10.2022	5	263 TAP_M6	Not found	"TAP_M6"	29	15:38:00,000 12.10.2022	
8 263 TAP_M6 Not found "TAP_M6" 29 15:39:25.000 12.10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:25.000 12.10.2022 10 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:40:33.000 12.10.2022 11 263 TAP_M6 Not found "NC_SPOT_DRILL_D10 17 15:40:33.000 12.10.2022 12 5 DRILL_D5 OK "DRILL_D5" 39 15:41:19.000 12.10.2022 13 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_BRILL_D10 17 15:41:19.000 12.10.2022 14 263 TAP_M6 Not found "NC_SPOT_BRILL_D10 17 15:42:15.000 12.10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:15.000 12.10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12.10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12.10.2022 16FF <td>8 263 TAP_M6 Not found "TAP_M6" 29 15:39:25.000 12.10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:25.000 12.10.2022 10 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:40:33.000 12.10.2022 11 263 TAP_M6 Not found "NC_SPOT_DRILL_D10 17 15:40:33.000 12.10.2022 12 5 DRILL_D5 OK "DRILL_D5" 39 15:41:19.000 12.10.2022 13 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:41:19.000 12.10.2022 14 263 TAP_M6 Not found "NC_SPOT_DRILL_D10 17 15:42:15.000 12.10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:15.000 12.10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12.10.2022</td> <td>6</td> <td>5 DRILL_D5</td> <td>ОК</td> <td>"DRILL_D5"</td> <td>39</td> <td>15:38:29,000 12.10.2022</td> <td></td>	8 263 TAP_M6 Not found "TAP_M6" 29 15:39:25.000 12.10.2022 9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:25.000 12.10.2022 10 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:40:33.000 12.10.2022 11 263 TAP_M6 Not found "NC_SPOT_DRILL_D10 17 15:40:33.000 12.10.2022 12 5 DRILL_D5 OK "DRILL_D5" 39 15:41:19.000 12.10.2022 13 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:41:19.000 12.10.2022 14 263 TAP_M6 Not found "NC_SPOT_DRILL_D10 17 15:42:15.000 12.10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:15.000 12.10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12.10.2022	6	5 DRILL_D5	ОК	"DRILL_D5"	39	15:38:29,000 12.10.2022	
9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:54.000 12:10.2022 10 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:40:33.000 12:10.2022 11 263 TAP_M6 29 15:40:30.000 12:10.2022 12 5 DRILL_D5 OK "DRILL_D5" 39 15:41:19.000 12:10.2022 13 203 NC_SPOT_DRILL_D10 NOT found "NC_SPOT_DRILL_D10 17 15:41:19.000 12:10.2022 14 263 TAP_M6 29 15:42:15.000 12:10.2022 14 14 263 TAP_M6 29 15:42:15.000 12:10.2022 10 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12:10.2022 10 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12:10.2022 10	9 5 DRILL_D5 OK "DRILL_D5" 39 15:39:54,000 12:10.2022 10 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:40:33.000 12:10.2022 11 263 TAP_M6 Not found "TAP_M6" 29 15:40:50.000 12:10.2022 12 5 DRILL_D5 OK "DRILL_D5" 39 15:41:19.000 12:10.2022 13 203 NC_SPOT_DRILL_D10 NOT found "NC_SPOT_DRILL_D10 17 15:41:58.000 12:10.2022 14 263 TAP_M6 NOT found "NC_SPOT_DRILL_D10 17 15:41:58.000 12:10.2022 14 263 TAP_M6 29 15:42:15.000 12:10.2022 100 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12:10.2022 100	7	203 NC_SPOT_DRILL_D10	Not found	"NC_SPOT_DRILL_D10	17	15:39:08,000 12.10.2022	
10 203 NC_SPOT_DRILL_D10 Not round "NC_SPOT_DRILL_D10 17 15:40:33.000 12:10.2022 11 263 TAP_M6 Not round "TAP_M6" 29 15:40:50.000 12:10.2022 12 5 DRILL_D5 OK "DRILL_D5" 39 15:41:19.000 12:10.2022 13 203 NC_SPOT_DRILL_D10 Not round "NC_SPOT_DRILL_D10 17 15:41:58.000 12:10.2022 14 263 TAP_M6 Not round "NC_SPOT_DRILL_D10 17 15:42:15.000 12:10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:15.000 12:10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12:10.2022 (6) DFF OFF 39 15:42:44.000 12:10.2022 S1001	10 203 NC_SPOT_DRILL_D10 Not round "NC_SPOT_DRILL_D10 17 15:40:33.000 12:10.2022 11 263 TAP_M6 Not round "TAP_M6" 29 15:40:50.000 12:10.2022 12 5 DRILL_D5 OK "DRILL_D5" 39 15:41:19.000 12:10.2022 13 203 NC_SPOT_DRILL_D10 Not round "NC_SPOT_DRILL_D10 17 15:44:19.000 12:10.2022 14 263 TAP_M6 Not round "NC_SPOT_DRILL_D10 17 15:42:15.000 12:10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:15.000 12:10.2022 16 25 TAP_M6 Not round "NC_SPOT_BRILL_D10 17 15:42:44.000 12:10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12:10.2022 S1001	8	263 TAP_M6	Not found	"TAP_M6"	29	15:39:25,000 12.10.2022	
11 263 TAP_M6 Not found "TAP_M6" 29 15:40:50.000 12:10.2022 12 5 DRILL_D5 OK "DRILL_D5" 39 15:41:19.000 12:10.2022 13 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:41:58.000 12:10.2022 14 263 TAP_M6 Not found "TAP_M6" 29 15:42:15.000 12:10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12:10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12:10.2022	11 263 TAP_M6 Not found "TAP_M6" 29 15:40:50.000 12:10.2022 12 5 DRILL D5 OK "DRILL_D5" 39 15:41:19.000 12:10.2022 13 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:41:58.000 12:10.2022 14 263 TAP_M6 Not found "TAP_M6" 29 15:42:14.000 12:10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12:10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12:10.2022	9	5 DRILL_D5	OK	"DRILL_D5"	39	15:39:54,000 12.10.2022	_
12 5 DRILL_D5 OK "DRILL_D5" 39 15:41:19.000 12.10.2022 13 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:41:58.000 12.10.2022 14 263 TAP_M6 29 15:42:15.000 12.10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12.10.2022 I6FF I6 I6 I6 I6 I6 I6 I6	12 5 DRILL_D5 OK "DRILL_D5" 39 15:41:19.000 12.10.2022 13 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:41:58.000 12.10.2022 14 263 TAP_M6 29 15:42:15.000 12.10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12.10.2022	10	203 NC_SPOT_DRILL_D10	Not found	"NC_SPOT_DRILL_D10	17	15:40:33,000 12.10.2022	_
13 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:41:88.000 12.10.2022 14 263 TAP_M6 Not found "TAP_M6" 29 15:42:15.000 12.10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12.10.2022 () () () () () () () () () ()	13 203 NC_SPOT_DRILL_D10 Not found "NC_SPOT_DRILL_D10 17 15:41:88.000 12.10.2022 14 263 TAP_M6 Not found "TAP_M6" 29 15:42:15.000 12.10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12.10.2022 () () () () () () () () () ()	11	263 TAP_M6	Not found	"TAP_M6"	29	15:40:50,000 12.10.2022	
14 263 TAP_M6 Not found "TAP_M6" 29 15:42:15.000 12.10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12.10.2022 () () () () () () () () () ()	14 263 TAP_M6 Not found "TAP_M6" 29 15:42:15.000 12.10.2022 15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12.10.2022 (*) OFF (*)	12	5 DRILL_D5	OK	"DRILL_D5"	39	15:41:19,000 12.10.2022	
15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44,000 12.10.2022	15 5 DRILL_D5 OK "DRILL_D5" 39 15:42:44.000 12.10.2022	13	203 NC_SPOT_DRILL_D10	Not found	"NC_SPOT_DRILL_D10	17	15:41:58,000 12.10.2022	
F1007	F1007	14	263 TAP_M6	Not found	"TAP_M6"	29	15:42:15,000 12.10.2022	\$100%
F1007	F 1007	15	5 DRILL_D5	OK	"DRILL_D5"	39	15:42:44,000 12.10.2022	

The "T usage order" table shows the tool sequence of the pending pallet or NC program. Before starting the program, you can see, for example, when a manual tool change will take place. When you select an NC program in the Program Run operating mode, the control automatically creates the "T usage order" table. The control lists all the tools called within the active NC program in chronological order.

The expanded tool management enables you to detect the tool requirements in time and thus prevent interruptions during program run.

BEGIN	END	PAG
		A
4	1	T

Advanced Function Set Turning*	SIK
	Option 158
	ID 1237237-01
TNC7/TNC7 basic TNC 640 TNC 620 / TNC 320	– From NC SW 34059x-09 through 34059x-16 –

* Advanced Function Set Turning additionally requires the Turning software option

Turning v2*	SIK	SIK2
	Option 158	4-03-2
	ID 1359635-01	ID 1395877-02
TNC7	NC SW 81762x-16 and later	
TNC7 basic	-	
TNC 640	NC SW 34059x-17 and later	
TNC 620 / TNC 320	-	

Installation by the machine manufacturer

For more information, see the TNC brochures, and visit www.klartext-portal.com

Ext. Tool Management

TNC7 **TNC7** basic **TNC 640 TNC 620 TNC 320**

Installation by the mac

For more information, see the TNC brochures, and visit www.klartext-portal.com

* Turning v2 includes the **Turning** software option


:	SIK	SIK2
	Option 93	2-03-1
	ID 676938-01	ID 1395858-01
	NC SW 81762x-16 and l NC SW 81762x-18 and l NC SW 34059x-01 and l NC SW 81760x-03 and l NC SW 771851-02 and	ater later later
hine manufacture	r	

Interpolation turning with an interpolating spindle

In interpolation turning, the tool's cutting edge describes a circular motion, with the cutting edge always oriented either toward the center of the circle (outside machining) or away from the center (inside machining). By varying the circle radius and the axial position, any rotationally symmetrical object can be produced in any working plane.

With the interpolation turning cycle, the TNC can create a rotationally symmetrical shoulder defined by its start and end point in the active working plane. The center of rotation is the starting point in the working plane when the cycle is called. The rotational surfaces can be inclined or rounded away from each other.

This cycle can be used only for finishing work and does not permit roughing operations with multiple passes. The machining strategy can be selected as needed: both inside machining and outside machining are possible. The TNC7 and TNC 640 also let you machine any rotationally symmetrical contour (without undercuts).

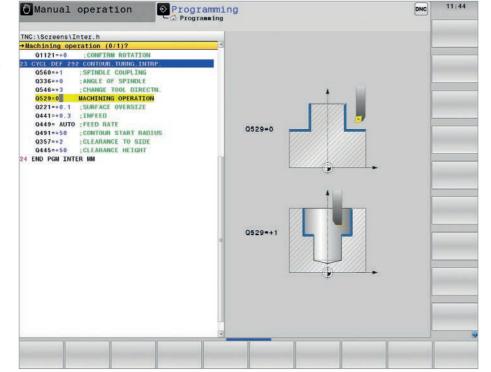

Adv. Spindle Interpol.	SIK	SIK2	
	Option 96	7-04-1	
	ID 751653-01	ID 1395892-01	
TNC7	NC SW 81762x-16 and later		
TNC7 basic	-		
TNC 640	NC SW 34059x-05 and later		
TNC 620	-		
TNC 320	-		
Installation by the machine manufacturer			


For more information, see the TNC brochures, and visit www.klartext-portal.com

Programming and operation Spindle synchronization

For certain machining operations, the rotations of the tool spindle must be synchronized with the movement of other axes. This is the case, for example, during the production of external gears via hobbing.

When using the Turning or Turning v2 software option in combination with Spindle Synchronism, the control offers Cycle 880 GEAR HOBBING, which allows you to machine external cylindrical gears or helical gears at any angle. During hobbing, the rotation of the tool spindle and rotary table are synchronized while the gear hob moves axially along the workpiece. Cycle 880 automatically controls these complex movements and lets you easily enter all of the relevant values. You can utilize the tooth parameters straight out of your drawing, which the cycle then uses to calculate the required five-axis motion.

The TNC 640 (with NC SW 34059x-11 and later) and TNC7 controls support tapping with one or more spindles. The spindles can be coupled for this purpose. Tapping is performed with the master spindle. The coupled slave spindles follow the machining operation.

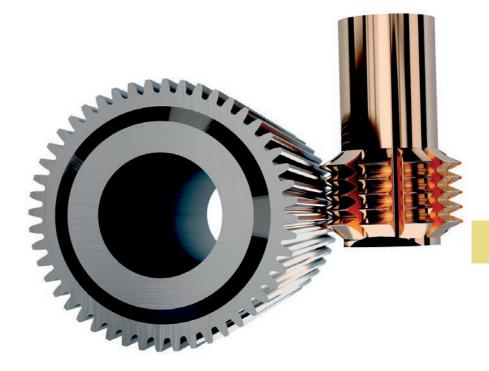

Spindle Synchronism

TNC7 TNC7 basic **TNC 640 TNC 620 TNC 320**

Installation by the machine manufacturer

For more information, see the TNC brochures



SIK Option 131 ID 806270-01 SIK2 7-02-1 ID 1395890-01

NC SW 81762x-16 and later

NC SW 34059x-05 and later

Grinding and dressing functions

With the TNC7 and TNC 640, you can even perform grinding operations on your machine. Cycles for jig grinding and dressing allow you to program the respective function with great convenience. The TNC7 and TNC 640 can also superimpose a tool-axis reciprocating stroke onto the programmed movements. Optimized tool management assists the user during every process, including grinding and dressing. The TNC7 and TNC 640 are therefore the ideal basis for attaining exceptional surface quality and accuracy in your applications.

Jig grinding


Jig grinding is the grinding of a 2D contour. On a milling machine, jig grinding is primarily used for finishing holes or premachined contours using a grinding tool. The grinding contour can be programmed in the defined grinding cycles and then machined.


Grinding open and closed contours

You also have the option of superimposing a tool-axis reciprocating stroke onto the tool's motion. Special cycles allow you to define, start, and stop the reciprocating stroke. The reciprocating stroke enables uniform wear on the grinding tool and precise geometries on ground surfaces.

Dressing

Dressing cycles allow you to "true up" grinding tools inside the machine. During dressing, the grinding tool is machined with a special dressing tool. Klartext cycles are available for dressing the grinding tool's diameter or profile.

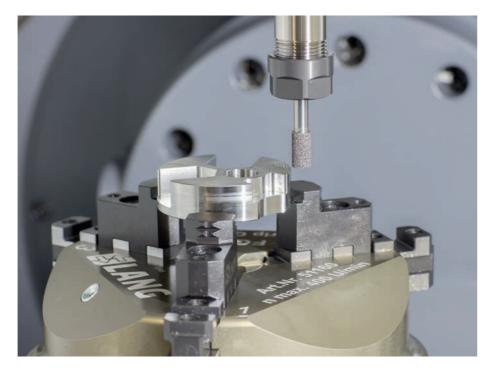

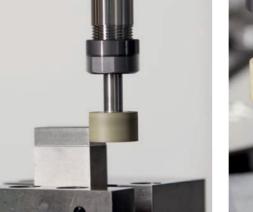



Grinding	SIK	SIK2
	Option 156	4-04-1
	ID 1237232-01	ID 1395878-01
TNC7	NC SW 81762x-16 and later	
TNC7 basic	-	
TNC 640	NC SW 34059x-10 and later	
TNC 620	_	
TNC 320	_	

Installation by the machine manufacturer

For more information, see the TNC brochures, and visit www.klartext-portal.com

Programming and operation Creating gears in a single setup

Because gears are typically manufactured on specialized machine tools, timeconsuming rechucking is often required.

With the Gear Cutting software option, however, you can completely machine spur and helical gears in a single setup using skiving or hobbing operations. If you wish to use this software option in turning mode, then the **Turning** or **Turning v2** software option will need to be enabled. The function helps you program complex sequences: all you need to define is just the gear geometry and tool data. The control will take care of the remaining calculations, particularly the complex synchronization of motions. As a result, the production of internal gears turns into an easy-to-master standard application.

Skiving

Skiving owes its current success to its significantly higher efficiency and throughput compared with traditional gear shaping.

With skiving, external and internal gears can be produced on machines with synchronized spindles. You can also, for example, use an individual tooth flank line to produce crowning of the tooth flank (starting with NC software 18).

Hobbing

Hobbing is particularly well suited to external gear machining. Its benefits include high throughput and a wide variety of tooth shapes that can be produced with relatively easy-to-make tools.


Lift-off


This software option not only makes programming easier but also provides better protection for your equipment. To prevent damage during unforeseen program interruptions (e.g., a power outage), its cycles support optimized lift-off capability. These cycles automatically define the tool direction and path for retraction from the workpiece.

Gear Cutting

TNC7 TNC7 basic **TNC 640 TNC 620 TNC 320**

Installation by the machine manufacturer

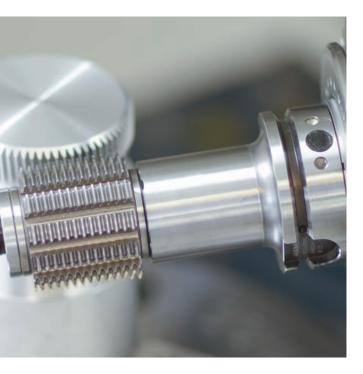

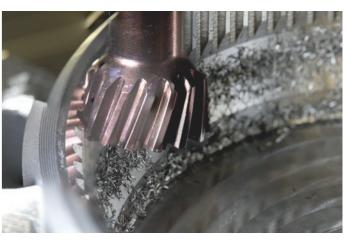

SIK	SIK2
Option 157	4-05-1
ID 1237235-01	ID 1395879-01
NC SW 81762x-16 and	later
-	
NC SW 34059x-09 and	later
-	
-	

For more information, see the TNC brochures, and visit www.klartext-portal.com

Machine accuracy KinematicsOpt for easy calibration measurements of rotary axes

Machine accuracy

KinematicsComp for correcting 3D spatial errors

Accuracy requirements are becoming increasingly stringent, particularly when it comes to five-axis machining. Complex parts are expected to be machined to exact specifications with reproducible accuracy over extended periods.

The KinematicsOpt software option for TNC controls is a key ingredient in helping you meet these high demands. First, a probing cycle automatically measures your machine's rotary axes with a HEIDENHAIN touch probe.

To measure the rotary axes, a calibration sphere is fixed on the machine table and probed with the HEIDENHAIN touch probe. Prior to probing, you specify the touch point grid and define a different measuring range for each rotary axis.

Based on the measured values, the TNC determines the spatial errors that arise from axis tilting. The cycle then calculates an optimized kinematic machine description that minimizes these errors and saves it as the machine's kinematic model.


Of course, a detailed log file is also available containing the actual measured values, the measured and optimized dispersion (for the static tilting accuracy), and the actual compensation values. Together with the KinematicsComp software option, the KinematicsOpt software option permits compensation for spatial misalignment of the rotary axes and makes 3D compensation of rotary swivel heads on a rotary axis grid possible.

Optimal use of KinematicsOpt requires a highly rigid calibration sphere for reducing the deformations caused by probing forces. For this purpose, HEIDENHAIN offers calibration spheres with highly rigid holders of various lengths.

Calibration spheres are available as accessories:

Height: 80 mm ID 655475-03 KKH 80 Height: 250 mm ID 655475-01 KKH 250



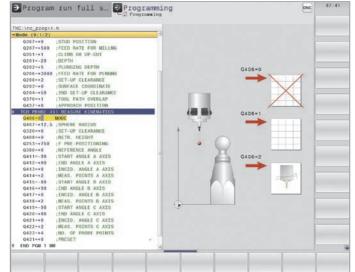

KinematicsOpt	SIK	SIK2
	Option 48	2-01-1
	ID 630916-01	ID 1395856-01
TNC7 TNC7 basic TNC 640 TNC 620 TNC 320	NC SW 81762x-16 and later NC SW 81762x-18 and later NC SW 34059x-01 and later NC SW 34056x-03/73498x-01/81760x-01 and later –	

Installation by the machine manufacturer

For more information, see the TNC brochures, and visit www.klartext-portal.com

Tight workpiece tolerances require high machine accuracy. However, machine tools inevitably exhibit installation- or productionrelated errors.

The more axes a machine has, the more sources of error there are. The ISO 230-1 standard, for example, lists eight relevant types of error for a linear axis (six component errors and two relevant position errors) and eleven for a rotary axis (six component errors and five relevant position errors). Counteracting such errors at the mechanical level requires extraordinary design effort. Moreover, these errors are particularly noticeable on five-axis machines and very large machines. What should also not to be neglected is thermal expansion, which can cause highly complex changes in the geometry of machine components.


The KinematicsComp software option gives machine manufacturers a way to significantly improve a machine's accuracy. The TNC's standard kinematic model describes the machine's degrees of freedom and the rotational centers of its rotary axes. The enhanced kinematics description of KinematicsComp additionally includes the option of considering positioning, straightness and angular errors of all axes through compensation value tables. In addition to featuring multidimensional tables, KinematicsComp also uses formulas with which even errors beyond the scope of the rigid body error model can be compensated for. This is done so well that the tool center point (TCP) can exactly follow the ideal nominal contour. Even thermally induced errors can be compensated for after being detected by sensors and the PLC. The spatial errors of the tool center point, for example, can be measured with a laser tracer or laser interferometer and converted into compensation tables. The KinematcsOpt software option uses the KinematicsComp software option to compensate for the misalignment of rotary axes and for the grid compensation of rotary swivel heads.



TNC7 **TNC7** basic **TNC 640 TNC 620 TNC 320**

Installation by the mac

For more information, see the TNC brochures, and visit www.klartext-portal.com

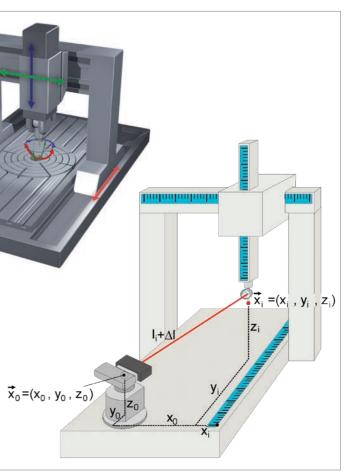

Determining geometric deviations with a laser-based coordinate measuring device (Source: PTB-Mitteilung volume 117)


	SIK	SIK2	
	Option 52	2-04-1	
	ID 661879-01	ID 1395859-01	
	NC SW 81762x-16 and I	ater	
	-		
	NC SW 34059x-05 and	later	
	-		
	-		
hine manufacturer			

Machine accuracy Correcting position errors due to axis coupling (CTC)


During dynamic acceleration processes, a machine tool's structure undergoes forces capable of deforming machine components, resulting in errors at the tool center point (TCP). The dynamic acceleration of an axis causes not only axial deformations but also deformations that are lateral to the direction of acceleration (due to mechanical axis couplings). This is especially the case if the point of force applied to an axis does not coincide with its center of gravity, thus potentially resulting in pitching motion during braking and acceleration phases. The resulting position error at the TCP in the direction of the accelerated axis and lateral axes is proportional to the amount of acceleration.

If the dynamic position error as a function of the axis acceleration is known from measurements at the TCP, then this acceleration-dependent error can be compensated for with the Cross Talk Compensation software option in order to prevent negative effects on the surface quality and accuracy of the workpiece.

A grid encoder (KGM) in the plane defined by two mechanically coupled axes can be used to measure the accelerationdependent position error of these axes. The resulting error at the TCP often depends not only on the acceleration but also on the position of the axes in the working space. The Cross Talk Compensation software option can take this into account as well.

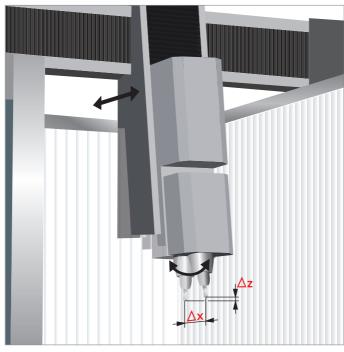

Deflection at the TCP in the Z axis during movement in the X direction

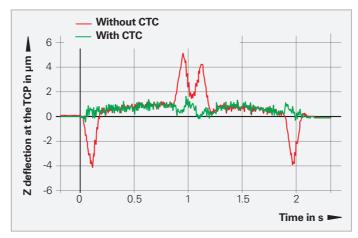

Servo control optimized for Z = 0; servo lag within the tolerance band

Op	ption 141	
		2-20-1
ID	800542-01	ID 1395862-01
TNC7 basic NC TNC 640 NC	NC SW 81762x-16 and later NC SW 81762x-18 and later NC SW 34059x-02 and later NC SW 34056x-04/73498x-02/81760x-01 and late –	
Installation by the machine manufacturer		

For more information, see the TNC brochures and the Dynamic Precision Technical Information document, and visit www.klartext-portal.com


Machine accuracy Position-dependent adaptation of control parameters (PAC)

Depending on the positions of the axes in the working space, a machine's kinematics give rise to variable dynamic behavior that can adversely affect servo-control stability.

To take full advantage of the machine's dynamic performance, the **Position** Adaptive Control software option enables

changes to machine parameters based on position, thus permitting assignment of the respective optimal loop gain to defined interpolation points. Additional positiondependent filter parameters can be defined in order to further increase control loop stability.



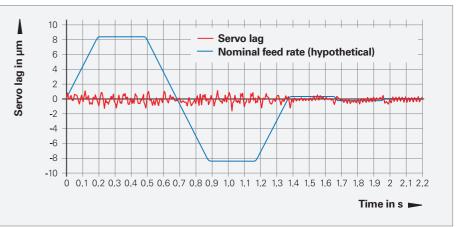

Servo control optimized for Z = 0; servo lag within the tolerance band ($\pm 1 \mu m$)

precision




servo lag ($\pm 3 \,\mu$ m) outside of the tolerance

• With active PAC: servo lag within the

tolerance band (±1 µm)

dynamic

hand

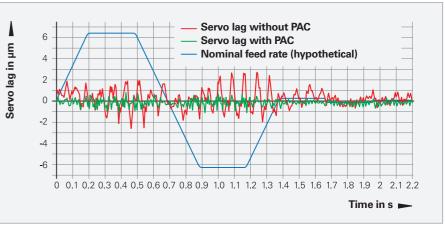

Position Adapt. Contr.

TNC7	
TNC7 ba	sic
TNC 640)
TNC 620)
TNC 320	
1140 520	'

Installation by the machine manufacturer

SIK	SIK2
Option 142	2-21-1
ID 800544-01	ID 1395863-01
NC SW 81762x-16 and later NC SW 81762x-18 and later	

NC SW 34059x-02 and later NC SW 34056x-04/73498x-02/81760x-01 and later

For more information, see the TNC brochures and the Dynamic Precision Technical Information document, and visit www.klartext-portal.com

Machine accuracy Load-dependent adaptation of control parameters (LAC)

The dynamic behavior of machines with moving tables can vary depending on the mass or mass moment of inertia of the clamped workpiece.

The Load Adaptive Control software option enables the control to automatically ascertain the current workpiece mass or mass moment of inertia and the acting frictional forces. In order to ensure an optimum response to changes in machine behavior at different loads, adaptive feedforward controls can be activated, and the control loop gain can be changed based on the load.


In order to allow rapid adjustment in response to sudden changes in the load (e.g., from loading and unloading the workpiece), Cycle 239 is provided for ascertaining the current load status.




As a complement to the position-dependent adaptation of control parameters through the PAC software option, the **Motion** Adaptive Control software option provides a way of changing machine parameters based on other input quantities such as speed or motor acceleration. This motiondependent adaptation of the control parameters makes it possible, for example, to realize a velocity-dependent adaptation of the ky factor on motors that exhibit stability changes at different traversing velocities.

A further application is the accelerationdependent change of the tensioning torque between the master and slave axes for master-slave torque control.

With this software option, this configuration makes it possible to attain a significantly higher maximum acceleration at rapid traverse; for example, through parameterbased reduction of the tensioning torque at increasing acceleration.

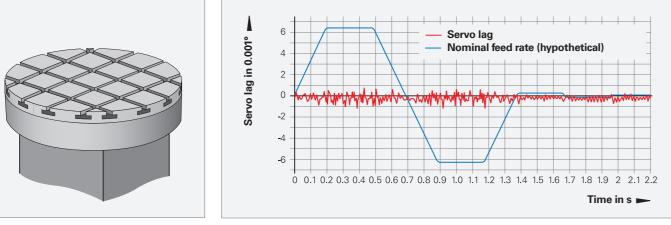


Optimal feedforward control for rotary tables without additional load and with servo lag within the tolerance band (±0.001°)

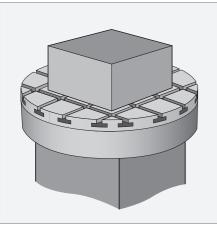

With change in load


- Without LAC: with unchanged feedforward control, the servo lag $(\pm 0.008^{\circ})$ is outside of the tolerance band
- With LAC: with feed-forward control and active LAC, the servo lag is within the tolerance band (±0.001°)



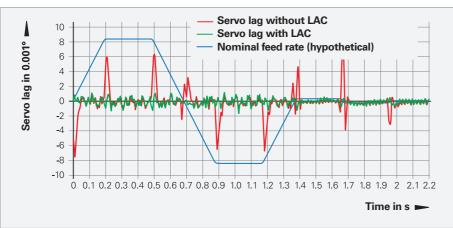


Load Adapt. Contr.	SIK	SIK2	
	Option 143	2-22-1	
	ID 800545-01	ID 1395864-01	
TNC7	NC SW 81762x-16	NC SW 81762×16 and later	
TNC7 basic	NC SW 81762x-18	NC SW 81762x-18 and later	
TNC 640	NC SW 34059x-02 and later		
TNC 620	NC SW 34056x-04/	73498x-02/81760x-01 and lat	
TNC 320	-		
Installation by the machine m	anufacturer		


For more information, see the TNC brochures and the Dynamic Precision Technical Information document, and visit www.klartext-portal.com

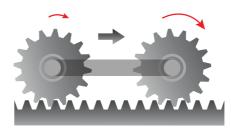

Without MAC

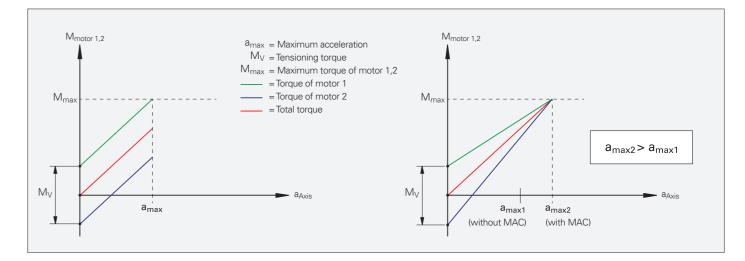

	Motion Adapt. Contr.	SIK	SIK2
		Option 144	2-23-1
		ID 800546-01	ID 1395865-01
dynamic precision	TNC7 TNC7 basic TNC 640 TNC 620 TNC 320	-	later
•	Installation by the machine manufacturerFor more information, see the TNC brochures and the <i>Dynamic Precision</i> Technical		
	Information document, and visit www	Information document, and visit www.klartext-portal.com	

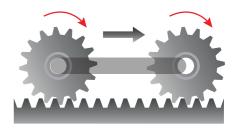

With MAC

Machine accuracy Active vibration damping (MVC)

In the presence of low-frequency vibrations on a machine tool, inclined or curved surfaces can often exhibit surface-finish problems in the form of visible shadows or inconsistent contrast. Peaks as small as 1 µm or smaller may be visually noticeable on a workpiece. These disturbances often necessitate surface rework, which comes with additional cost.


Low-frequency disturbances are often caused by elasticity in the drive train, such as vibrations between the motor and the slides, or machine setup vibrations, in which high accelerations of the machine axes cause disturbances in the machine tool through its fastening elements or connected base.

Excitations due to high accelerations can be lowered by reducing the jerk, but this results in longer machining times.

The Machine Vibration Control software option suppresses low-frequency vibrations via the control loop of the control. To this end, this software option provides the Active Vibration Damping (AVD) and Frequency Shaping Control (FSC) functions. MVC works in two ways: it results in a clean workpiece surface because any vibrations that would be visible on the workpiece surface are suppressed, and it also enables fast and low-vibration milling.

MVC thus increases the productivity of a machine tool and/or improves the surface quality of workpieces.



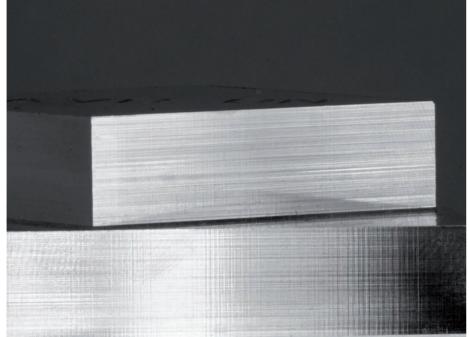

dynamic precision

Machine Vibr. Contr.	SIK	SIK2
	Option 146	2-24-1
	ID 800548-01	ID 1395869-01
TNC7 TNC7 basic TNC 640 TNC 620 TNC 320	NC SW 81762x-16 NC SW 81762x-18 NC SW 34059x-04 NC SW 34056x-04/ -	and later
Installation by the machine m	anufacturer	
For more information and the	TNC broch was and the Dur	panoia Dragician Tachaical

For more information, see the TNC brochures and the Dynamic Precision Technical Information document, and visit www.klartext-portal.com

Machining functions 5-axis simultaneous machining

The TNC provides many powerful functions specifically developed for five-axis simultaneous machining.

The NC programs for five-axis simultaneous machining are created with CAM systems in conjunction with postprocessors. In principle, such programs contain either all of the coordinates of the machine's existing NC axes or NC blocks with surface normal vectors. During five-axis machining with three linear axes and two additional tilting axes, the tool is always perpendicular to the workpiece surface or is tilted at a specific angle relative to it (inclined tool machining).

Regardless of the type of five-axis programs you wish to run, the TNC performs all of the necessary compensating movements in the linear axes arising from movements in the tilting axes. The TNC's tool center point management feature (TCPM)—an improvement on the proven TNC function M128—provides optimal tool guidance and prevents contour gouging.





Adv. Function Set 2

TNC7 TNC7 basic **TNC 640 TNC 620 TNC 320**

Installation by the machine manufacturer

For more information, see the TNC brochures

SIK

Option 9 ID 617921-01 SIK2 4-01-1 ID 1395875-01


NC SW 81762x-16 and later

NC SW 34059x-01 and later NC SW 34056x-01/73498x-01/81760x-01 and later

Machining functions Superimposing handwheel positioning during program run

The Handwheel Superimpositioning function (M118) enables you to make manual corrections with the handwheel during program run. This is particularly helpful when you wish to change the inclination angles of rotary axes: in externally written NC programs such changes often cause collisions between the tilting head and the workpiece. You can also use handwheel superimpositioning to adjust the offset compensation in linear axes without having to change the NC program.



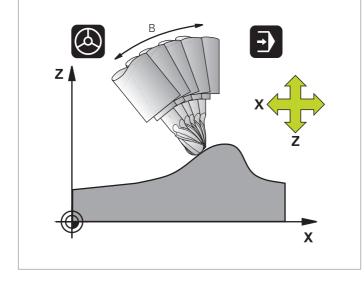

Adv. Function Set 3	SIK	SIK2
	Option 21	4-02-1
	ID 628254-01	ID 1395876-01
TNC7	Standard function	
TNC7 basic	NC SW 81762x-18 and later	
TNC 640	Standard function	
TNC 620	NC SW 34056x-01/73498x-01/81760x-01 and late	
TNC 320	Standard function	


Installation by the machine manufacturer

For more information, see the TNC brochures

Machining functions

Calculating contours with tool-radius offset in advance


The LOOK AHEAD function in the TNC's geometry processing system monitors radius-compensated contours for undercuts and intersections, and calculates the tool path in advance starting from the current block. Sections of the contour that would be damaged by the tool are simply not machined (dark areas in the figure) and can be reworked with a smaller tool at a later time. You can also use this function to add tool radius compensation to NC programs created with an external programming system and output as an uncompensated contour. Consequently, inaccuracies in the NC programs arising from calculations in the CAM system can be compensated for.

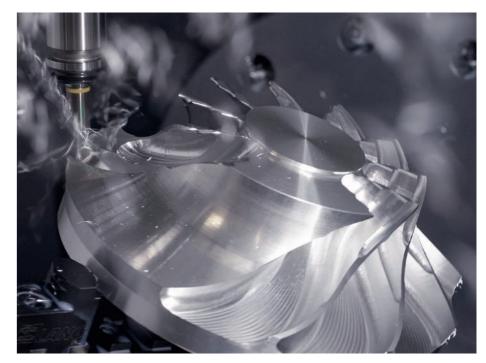

Adv. Function Set 3

TNC7 **TNC7** basic **TNC 640 TNC 620 TNC 320**

Installation by the machine manufacturer

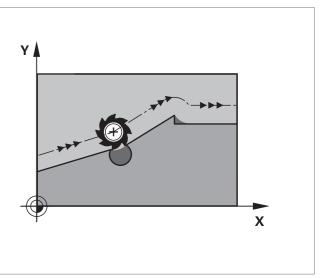

Э	ĸ	
-		

Option 21 ID 628254-01 SIK2

4-02-1 ID 1395876-01

Standard function NC SW 81762x-18 and later Standard function NC SW 34056x-01/73498x-01/81760x-01 and later Standard function

For more information, see the TNC brochures

Machining functions Dynamic collision monitoring (DCM)

The complex machine movements and normally high traversing speeds of five-axis machining make axis movements difficult to predict. This makes collision monitoring a valuable function that relieves the user and protects the machine from damage.


In cases such as these, the user is assisted by the **Collision Monitoring** software option of the TNC. The control interrupts the machining process whenever a collision is imminent, thus increasing overall safety. This, in turn, helps prevent machine damage and any resulting costly downtime. Unattended shifts also become more reliable.

Collision monitoring works not only in automatic mode but is also active in manual mode. If, for example, the user is on a collision course during setup, the TNC detects this, stops axis movement, and issues an error message. Before actually machining a part, you can also check for collisions in the simulation, with a real preset and real tools.

Of course, the TNC also shows the user which machine components are at risk, both by means of an error message and graphically. If a collision warning occurs, the TNC permits tool retraction only in directions that will increase the clearance between the colliding objects.

The TNC7, TNC7 basic, and the TNC 640 (with NC SW 34059x-05 and later) also offer a convenient way to import collision objects from standard CAD models (e.g., STL) into the control as M3D data. This permits highly detailed modeling of the machine components and better utilization of the machine's working space.

On the TNC7, TNC7 basic, and the TNC 640 (with NC SW 34059x-11 and later), clamping setups can be incorporated in *.cfq, *m3d, or *.stl formats, including via Klartext commands.

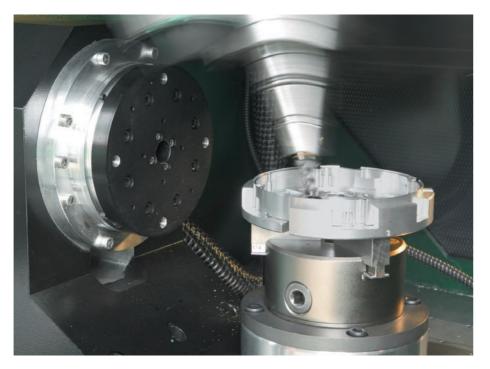

) Manual o	pention 2 NO	Te Sete	1 ²	+		SE Workspaces *
1 Positions			Nom	nal pos. (NOML) 🔹 🗖	× Esmulation) • ×
2 4	12 0					τ >
	S 51					
F	263 Z 💋 TAP_M6	····· 100%	n	100%		
S		∩ 100%	00	M5		
x	-107.4	a china channa a sha				
-						
Y	-141.4	78			19 A	
	444.4	00			H	
Z	-141.8	583			HIX	A A
Α	-85.1	45				
					E	
С	0.0	000			E	
-	? 0.0	000			E	
m	. 0.0	00				
S1	329.7	760				
-	1	27072 2				

Collision Monitoring	SIK	SIK2		
	Option 40	5-03-1		
	ID 526452-01	ID 1395882-01		
TNC7	NC SW 81762x-16	and later		
TNC7 basic	NC SW 81762x-18 and later NC SW 34059x-02 and later –			
TNC 640				
TNC 620				
TNC 320	-			
Installation by the machine manufacturer				

Installation by the machine manufacturer

For more information, see the TNC brochures, and visit www.klartext-portal.com

Machining functions Dynamic collision monitoring (DCM) version 2

The Collision Monitoring v 2 software option (DCM v 2) includes all functions of the Collision Monitoring software option. The expanded collision monitoring of the control not only prevents tools from colliding with machine components, but also with fixtures. The control features a probing function that graphically and interactively assists you in determining the exact position of the fixture. That way you no longer have to worry about either the sequence or the actual probing functions. Colored arrows in a virtualized work envelope show you whether the position is suitable and the probing operation can be performed. This graphically supported measurement can be used for any workholding equipment. An accurate 3D model is all that is needed. You can simplify and clean up the 3D model of your fixture using the CAD Model Optimizer software option, in order to create a valid STL file for collision monitoring.

40

With DCM v2 it is possible to machine right up to the fixture. Where necessary, you can enter a value smaller than the standard 2 mm between the tool and the fixture by simply programming the monitored distance in the NC program.

Any tool shapes can be integrated as 3D models (STL files). This results in the following benefits:

- Monitoring of the tool shaft for collisions
- Ability to protect tools of any shape from collisions with fixtures and machine components
- Realistic material-removal simulation
- Use of tools with any measurement reference point


(e.g., backward deburrers)

The collision protection provided by DCM v2 is only as good as the 3D models of the collision objects. For reliable machine operation, the digital data must match the physical reality. The import function of the OPC UA NC Server provides tool presetters and tool databases with functions for importing the 3D models of the tool and tool holder directly into the control. The model validation feature checks the 3D models during importing, thus ensuring maximum reliability of Collision Monitoring and the simulation (starting with NC software version 18).

Collision Monitoring v

TNC7
TNC7 basic
TNC 640
TNC 620
TNC 320

Installation by the mac

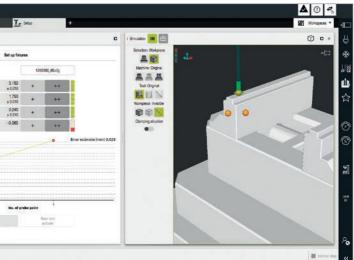

/2	SIK	SIK2
	Option 140	5-03-2
	ID 1353266-01	ID 1395882-02
	NC SW 81762x-16 and I NC SW 81762x-18 and I	
	-	
	-	
chine manufacture	r	

For more information, see the TNC7 brochure, and visit www.klartext-portal.com

Machining functions Global program settings

The global program settings, which come into play particularly in large-scale mold making, are available in the Program Run and MDI modes. This option lets you define global and overriding coordinate transformations and settings for the NC program without actually changing the NC program.

You can change the global program settings during a program stop, even in mid-program. A clearly structured form is provided for this. Upon restarting, the TNC then moves as needed to a new position in accordance with a positioning logic that you can define. The following functions are available:

- Additional rotation based on basic rotation or 3D basic rotation
- Shifting the workpiece preset in a single axis
- Mirroring individual axes
- Additional shift of an already shifted workpiece datum
- Rotation about the active tool axis
- Handwheel superimposition
- Feed rate factor

Handwheel superimpositioning is possible in various coordinate systems:

- Machine coordinate system
- Workpiece coordinate system (the active basic rotation is taken into account)
- Tilted coordinate system

You can select the desired coordinate system in a clearly structured form.





Global PGM Settings	SIK	SIK2	
	Option 44	1-06-1	
	ID 576057-01	ID 1395852-01	
TNC7	NC SW 81762x-16	and later	
TNC7 basic	-		
TNC 640	NC SW 34059x-08 and later		
TNC 620	-		
TNC 320	_		

Installation by the machine manufacturer

For more information, see the TNC brochures

Machining functions Adaptive feed control (AFC)

The Adaptive Feed Control software

option (AFC) automatically regulates the feed rate of the TNC based on the present spindle power and other process data. During a teach-in cut, the TNC records the maximum occurring spindle power. Prior to machining, you define the limits (in a table) within which the TNC is allowed to influence the feed rate in "control" mode. Naturally, various overload reactions can be specified as well, including by your machine manufacturer.

The TNC's Adaptive Feed Control option offers a series of benefits:

Optimization of the machining time

Particularly in the case of cast parts, oversizes and material irregularities (cavities) can occur to varying degrees. By controlling the feed rate, the control strives to stay within the bounds of the previously "learned" maximum spindle power throughout the entire machining time. Increasing the feed rate in areas requiring less material removal shortens the overall machining time.




Tool monitoring

Adaptive Feed Control continuously compares the spindle power with the feed rate. As a tool becomes blunt, the spindle power increases, causing the TNC to reduce the feed rate. As soon as the feed rate falls below a specified minimum, the TNC reacts with an NC stop or warning, or automatically replaces the tool. This prevents secondary damage after tool breakage or wear.

Protecting machine components

When the feed rate is reduced in response to the exceeded learned maximum spindle power, machine components undergo less strain. This protects the main spindle from overloading.

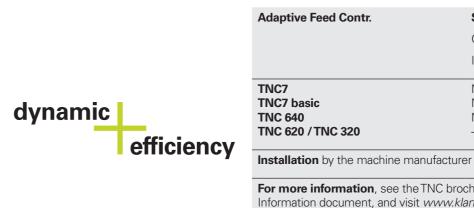

SIK

Option 45 ID 579648-01

SIK2

2-31-1 ID 1395871-01

NC SW 81762x-16 and later NC SW 81762x-18 and later NC SW 34059x-02 and later

For more information, see the TNC brochures and the Dynamic Efficiency Technical Information document, and visit www.klartext-portal.com


Machining functions Active chatter control (ACC)

Strong forces come into play during roughing (power milling). Depending on the rotational tool speed, the resonances in the machine tool, and the chip volume (metalremoval rate during milling), a phenomenon known as "chatter" may occur. Chatter induces heavy strain on the machine and causes ugly marks on the workpiece surface. It also increases the progress and irregularity of tool wear, even leading to tool breakage under extreme circumstances.


To reduce chatter susceptibility, HEIDENHAIN now offers a highly effective software option called Active Chatter **Control** (ACC). This control function is particularly advantageous when used during heavy machining. Thanks to ACC, substantially higher removal rates are possible. Depending on the type of machine, the removal rate can be increased by up to 25 percent or more. At the same time, you are reducing strain on the machine and increasing tool life.



Heavy machining without ACC

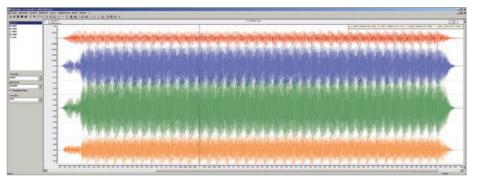

Servo lag without ACC

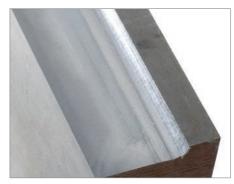

Heavy machining with ACC

Reduced servo lag with ACC

Active Chatter Contr.	SIK	SIK2	
	Option 145	2-30-1	
	ID 800547-01	ID 1395870-01	
TNC7	NC SW 81762x-16 and I	ater	
TNC7 basic	NC SW 81762x-18 and I	ater	
TNC 640	NC SW 34059x-02 and I	ater	
TNC 620	NC SW 34056x-04/7349	8x-02/81760x-01 and later	
TNC 320	-		
Installation by the machine manufactur	rer		

dynamic efficiency

Machining functions Optimized roughing processes with OCM

Efficient machining strategies are a key basis for economical NC manufacturing. Roughing processes, in particular, offer great potential for optimization because they usually take up a high share of total machining time.

Process reliability and maximum removal rates require optimal adaptation of the cutting data to the characteristics of the tool and workpiece material. The

Optimized Contour Milling software option (OCM) gives the user a cutting data calculator that draws on a comprehensive integral materials database. The user can adapt the automatically calculated cutting values with regard to the mechanical and thermal load on the tool. Tool service life can be managed with process reliability even at the highest possible removal rates.

With OCM, you can rough out any pocket and island with high process reliability and lower tool wear thanks to highly consistent process conditions. Simply program the contour as usual in Klartext, or leverage the convenient CAD Import software option. There you can extract contours or machining positions from your 3D model. The control then automatically calculates the complex movements required for maintaining consistent process conditions. OCM takes void areas into account, which significantly reduces machining times (with NC software version 16 and later).

Advantages of OCM over conventional machining:

- Reduced thermal load on the tool
- Superior chip removal
- Consistent tool contact conditions (higher cutting parameters and higher material removal rate)

OCM is an effective, reliable, and convenient way to improve your throughput:

- Create programs on the shop floor for any pocket or island
- Significantly higher machining speed
- Considerable reduction in tool wear
- More chips in less time

dynamic

Opt. Contour Milling

TNC7
TNC7 basic
TNC 640
TNC 620
TNC 320

Installation by the machine manufacturer

efficiency



OCM provides practical cycles for roughing, side-wall finishing, and floor finishing, as well as cycles for standard shapes, chamfering and deburring. (TNC 640: 34059x-11; TNC 620: 81760x-08).

In the following machining example, both the machining time and tool wear were reduced by a factor of three.

Conventional machining

S5000, F1200, a_p: 5.5 mm


Overlap factor: 5 mm

Machining with OCM


Overlap factor: 1.4 mm

Machining time: 21 min 35 s

Tool: VHM end mill Ø 10 mm Workpiece material: 1.4104

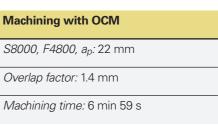


Tool: VHM end mill Ø 10 mm Workpiece material: 1.4104

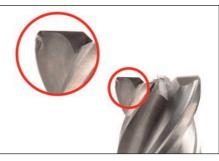

Tool after two parts



Tool after six parts

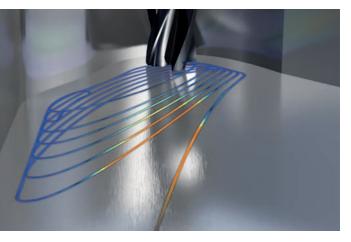

SIK Option 167 ID 1289547-01 SIK2 1-02-1 ID 1395833-01

NC SW 81762x-16 and later NC SW 81762x-18 and later NC SW 34059x-10 and later NC SW 81760x-07 and later NC SW 771851-18 and later

For more information, see the TNC brochures, and visit www.klartext-portal.com


Machining functions Monitoring loads on machine components


Overload often leads to damaged machine components, and therefore to machine downtime. For example, the spindle bearing is often subject to a very high load in machining strategies that have been optimized for maximum efficiency, and can therefore sustain undetected damage. The **Component Monitoring** software option can detect these dangers, and issue warnings or even stop the machine tool if necessary. Thanks to continuous monitoring of the bearing load and visualization of these values, the machining processes can be optimized correspondingly.

However, the production quality of a machine tool is influenced not only by overload. Components that are constantly under load, such as guideways or recirculating ball screws, are subject to wear and thus have an influence on the finished product. The TNC7 and TNC7 basic use this software option to ascertain and document the momentary machine status. The machine manufacturer can read and evaluate these data, and react using predictive maintenance, thereby avoiding unplanned machine downtime. The MONITORING HEATMAP function allows you to individually color, from within the NC program, the workpiece view of the concurrent simulation. That way you quickly see in the workpiece view where components were subject to a strong load.

Cycle 238, MEASURE MACHINE STATUS*, is part of the software option. This cycle allows you to ascertain and record the current machine status. Through data comparison, deviations in machine parameters can be detected and documented over extended periods of time, allowing you to track the machine aging processes.

* Available on the following controls: TNC7, TNC7 basic, TNC 640 (with NC SW 34059x-10 and later), TNC 620 (with NC SW 81760x-07 and later)

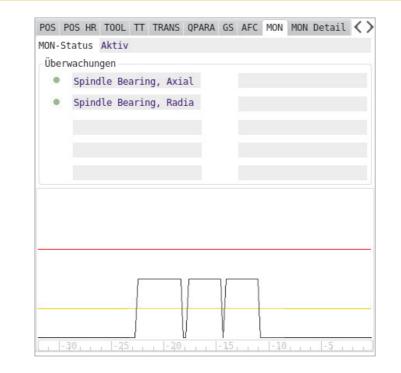

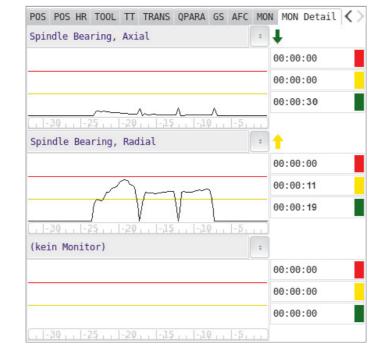

Component Monitoring	SIK	SIK2		
	Option 155	5-02-1		
	ID 1226833-01	ID 1395881-01		
TNC7	NC SW 81762x-16	and later		
TNC7 basic	NC SW 81762x-18 and later			
TNC 640	NC SW 34059x-09 and later			
TNC 620	NC SW 81760x-06 and later			
TNC 320	-			
Installation by the machine manu	ufacturer			

For more information, see the Information for Machine Manufacturers brochures

Machining functions

Monitoring the production process based on a teach-in cut

The fully-integrated process monitoring capability of the TNC7 is a unique feature for making production processes safer and more reliable. Reliable process monitoring is essential for preventing damage resulting from unavoidable disturbances during automated production. For example, if breakage inspection is performed for tools during the machining operations, then valuable productive time is lost. Here the user can save time and costs with the fullyintegrated process monitoring feature from HEIDENHAIN. Process monitoring entails the recording of one or more reference machining operations. During subsequent operations, the control monitors the process and can react to deviations in a timely manner. For example, if there is a disturbance in the process, the machine can be stopped and the tool disabled. In conjunction with pallet machining, the next workpiece can automatically be started with a replacement tool. That way the machine tool remains productive despite the disturbance, and no manual intervention is necessary. The Process **Monitoring** software option uses signals from within the control and does not require any additional sensors.

Process monitoring increases safety and efficiency:

- Detect deviations from a reference machining run
- Enjoy reliable monitoring thanks to robust program synchronization down to the block level
- Ensure productivity through an extensive range of possible reactions, such as inserting a replacement tool
- Easy checking of the process result via 3D visualization of the workpiece and a 2D graph
- Easy programming
- · Benefit from zero installation effort

Process Monitoring

TNC7
TNC7 basic
TNC 640
TNC 620
TNC 320

Installation by the machine manufacturer

For more information, see the TNC7 brochure, and visit www.klartext-portal.com

tengled 5.

WW 1009

-174.367

348.21

0 Z T

0=

! Processiberwachung		💿 🕲 🗆
	"Wasten" [25-44] Strange als Values spectrum - UnMosTatemore +	
Bauman	1, MethlasTolerance	\$ 0 Q
 Heaktonen alter überwachungsabe "Waelzen" (25-44) 		
Device		1 11 1
Alexandra Trianera a d'Manarter anal		1 1 1
New Day IL	we talent	A. An All I and the
27072022 18:43	marin Mannan was MM (PWV MB	LA MANALAPAK MANDI
7707202215-45	Berdügt mindenters allre Referenz Bendügt mindeste	
	Applete posetule Dericharg	Lale Absecturg 2 %
	Statute Terrebolis	ette
	Hultonit Hultonit	
		50 Millisekunde
	Peaktionen Peaktionen Wenung autoisin Wartung	g ausidean
		pp auslibeen
		wriauf abbrechen. ug sperren

SIK	SIK2
Option 168	5-01-1
ID 1302488-01	ID 1395880-01
NC SW 81762x-16 and I	ater
-	
-	
-	
-	

Machining functions 3D-ToolComp for 3D radius offset based on tool angle

Communication HEIDENHAIN OPC UA NC Server for standardized communication

3D-ToolComp is a powerful software option for three-dimensional tool radius compensation. In a compensation table, angle-dependent delta values are defined describing the tool's deviation from an ideal circular form (see figure). For use with a tool, this function requires surface normal vectors in the NC program, for which the **Advanced Function Set 2** software option must be enabled.

The TNC then corrects the radius value defined for the tool's current point of contact with the workpiece. In order to determine the point of contact exactly, the NC program must have been created with surface-normal blocks (LN blocks) by a CAM system. The surface-normal blocks specify the theoretical center point of the radius cutter and the tool orientation relative to the workpiece surface as needed.


The ideal method is to create the compensation table fully automatically. This is done by measuring the shape of the tool with a laser system and a special cycle such that the TNC can make immediate use of the table. If the form errors of the tool are already available to you in a calibration chart provided by the tool manufacturer, then you can also create a compensation table manually.

Measuring 3D geometries

The control features a cycle that allows you to measure points on 3D geometries. To do so, you simply enter the point to be measured, along with its coordinates and associated normal vectors, into Cycle 444, 3D PROBING. After probing, the TNC automatically calculates whether the measured point is within a specified tolerance. You can then call the result via system parameters in order, for example, to have the program initiate rework. You can also trigger a program stop and output a message. After measurement, the cycle automatically generates a straightforward measurement report in HTML format. To obtain even more accurate results, you can perform a 3D calibration of the touch probe prior to running Cycle 444. The cycle then compensates for the switching behavior of the individual touch probe in all directions.

The **3D-ToolComp** software option is required for 3D calibration.



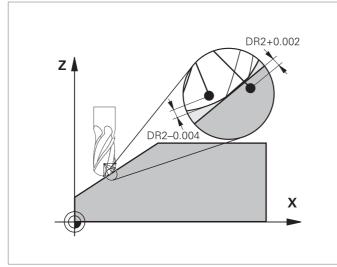

3D-ToolComp	SIK	SIK2	
	Option 92	2-02-1	
	ID 679678-01	ID 1395857-01	
TNC7	NC SW 81762x-16	and later	
TNC7 basic	-		connected
TNC 640	NC SW 34059x-07	' and later	connected
TNC 620	-		
TNC 320	-		
Installation by the user			-

For more information, see the TNC brochures, and visit www.klartext-portal.com

The OPC UA NC Server software option

offers an interface based on OPC UA for HEIDENHAIN controls. OPC UA is a crossoperating-system interface that can connect the HEIDENHAIN control not only to widespread Windows systems but also to Linux-based systems and Apple computers with macOS. Numerous developer toolkits are available for OPC UA. RemoTools SDK is not needed. This option's standardized protocol, freely selectable toolkit, and application-oriented HEIDENHAIN information model allow standard software solutions and highly individualized applications to be developed with significantly less time to market. The HEIDENHAIN OPC UA NC Server supports the following functions:

- Reading and writing variables
- Subscribing to value changes
- Executing methods
- Subscribing to events
- Transferring of files

Six SIK options are available for the HEIDENHAIN OPC UA NC Server. Each of the six SIK options enables an incoming OPC UA connection. Multiple connections can be configured and activated as needed on the control. When using a SIK2 and option 3-02-1, ten incoming connections are available. (SIK2 options can be purchased more than once.)

Explore the full HEIDENHAIN OPC UA NC Server yourself and test new OPC UA applications on a virtual machine such as the HEIDENHAIN programming station. Current versions of the programming station feature a free, full-version demo of the OPC UA NC Server.


Classification


Machine identification

- Production data acquis
- Machine messages
- Program sequence che
- File transferRemote management file systems
- OEM enhancements

• Tool data management

- Import of 3D tool mode DCM v2
- Other encryption algor
- Various service functio

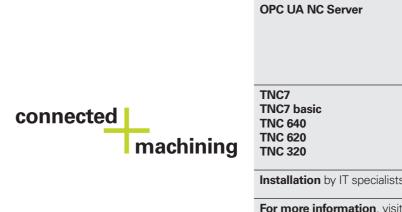

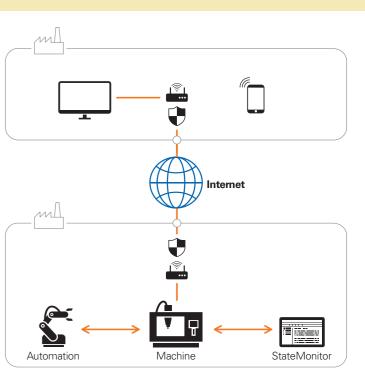

	TNC7 Minimum NC SW	TNC7 basic Minimum NC SW	TNC 640 Minimum NC SW	TNC 620 Minimum NC SW
n sition neck	81762x-16	81762x-18	34059x-10	81760x-08
t of	81762x-16	81762x-18	34059x-11	81760x-08
(e.g., PLC)	81762x-16	81762x-18	34059x-16	81760x-16
nt	81762x-17	81762x-18	34059x-17	81760x-17
dels for rithms ons	81762x-18	81762x-18	34059x-18	81760x-18

	SIK	SIK2
	Options 56 to 61	3-02-1
	ID 1291434-01 to ID 1291434-06	ID 1395873-01
	NC SW 81762x-16 and NC SW 81762x-18 and NC SW 34059x-10 and NC SW 81760x-08 and –	later later
S		

For more information, visit www.heidenhain.de/opcua-nc-server

Communication HEIDENHAIN DNC for communication over a COM component

Paperless job management requires the seamless exchange of data about all process steps in the production process. The **HEIDENHAIN DNC** software option allows a Windows application to access data on the control and change them as needed. Possible fields of application include the following:

- Software solutions for controlling the manufacturing process
- Machine data acquisition systems and production data acquisition systems (MDA/PDA)
- Connection to higher-level ERP/MES svstems
- Preventive maintenance planning based on the machine's actual condition
- Standard or customized PC software - Greater process reliability and equipment availability
- Error reporting systems (e.g., notifying the customer's smartphone when the current machining process encounters problems)
- Current status overviews of all production machines
- Database creation for extensive data mining

Since HEIDENHAIN DNC has been around for many years already, the interface is also particularly suitable for connecting older machine tools.

RemoTools SDK development package

In order for you to make use of the HEIDENHAIN DNC software interface, HEIDENHAIN offers the RemoTools SDK software development package. RemoTools SDK provides a Microsoft COM component for development environments on Windows operating systems, thus enabling communication with the HEIDENHAIN control. The COM component is registered in the Windows operating system during installation of RemoTools SDK.

connected	
	machining

rsion Co	onfiguration	FileSystem PLC	ProcessData Automati	c DataAccess	TNCTable Error	AxesPosition Stream	aming Trace	
				Clear all e	errors on TNC			
Channel	Number	Text		Group		Class	Arrived	Gone
0	13155	N13155: DCM	Tool - Table_fix	DNC_	EG_OPERATING	DNC_EC_NONE	16.07.2014 10:52:43	16.07.2014 10:52:45
0	17738	N17738: Ends					16.07.2014 10:52:52	
0	17739	N17739: Ends	chalter Y-				16.07.2014 10:53:07	
0	183	N183: Aktuelle	r Satz nicht angewählt	DNC_	EG_OPERATING	DNC_EC_NONE	16.07.2014 10:53:28	
	lear List	_						Save List



HEIDENHAIN DNC	SIK	SIK2	
	Option 18	3-03-1	
	ID 526451-01	ID 1395874-01	
RemoTools SDK	Accessory, ID 340442-x	x	
TNC7	NC SW 81762x-16 and later		
TNC7 basic	NC SW 81762x-18 and later		
TNC 640	NC SW 34059x-01 and later		
TNC 620	NC SW 34056x-01/73498x-01/81760x-01 and later		
TNC 320	NC SW 34055x-01/7718	51-01 and later	
Installation by the user			

For more information, see the TNC brochures and the *Connected Machining* brochure

Communication

Remote Desktop Manager for viewing and remotely operating external computers

A typical work day may often require data entry into planning and control systems or diagnostic testing with Windows-based software. The Remote Desktop Manager software option provides the user with the opportunity to operate one or more Windows PCs directly from the TNC. This option fully integrates the Windows PC operating interface into the control interface on the TNC's screen.

This functionality is available regardless of whether the Windows PC is an industrial PC (e.g., the IPC 306) in the machine's control cabinet, in the local network as a server, or at the user's office workstation.

Possible applications range from centralized job, tool, and NC program management to the remote operation of CAD/CAM systems from the machine. With this option, the machine tool operating panel becomes a versatile and efficient workspace for tasks ranging from specialized manufacturing processes to decentralized order processing.



Remote Desk. Manager

connected machining

TNC7 **TNC7** basic **TNC 640 TNC 620 TNC 320**

Installation by IT specialists





Extended Workspace Comfort

Extended Workspace Comfort

With Extended Workspace Comfort, you can add a second 19-inch HEROS screen next to or above the control's main screen. While the current NC program is displayed on the control screen, Extended Workspace Comfort offers, for example, a view of an office PC that is connected via Remote Desktop Manager.

Extended Workspace Compact

Extended Workspace Compact lets any additional applications run in an extra window on a 24-inch touchscreen of the control; for example, the screen of a Windows PC can be shown. Its position alongside the familiar control screen gives you an optimum overview.

Embedded Workspace

The TNC7 and TNC7 basic offer the possibility of seamlessly embedding remote desktops or applications as a workspace or separate operating mode directly in the user interface of the TNC7 and TNC7 basic. The workspaces are therefore able to display the content in an optimized way in the display areas selected by the user.



SIK
Option 133
ID 894423-01

SIK2 3-01-1

ID 1395872-01

NC SW 81762x-16 and later NC SW 81762x-18 and later NC SW 34059x-02 and later NC SW 81760x-02 and later NC SW 77185x-04 and later

For more information, see the TNC brochures and the *Connected Machining* brochure

Machine interfacing Additional control loops


The number of enabled control loops depends on the SIK being used and on any additionally enabled control loops (which can be ordered at any time as needed).

Additional control loops can be enabled either singly or in groups. Through combinations of control-loop groups and single control loops, any number of control loops can be enabled.

The maximum possible number of control loops depends on the control:

 TNC7: 	24 control loops
 TNC7 basic: 	8 control loops
• TNC 640:	24 control loops

- TNC 620: 8 control loops
- TNC 320: 6 control loops

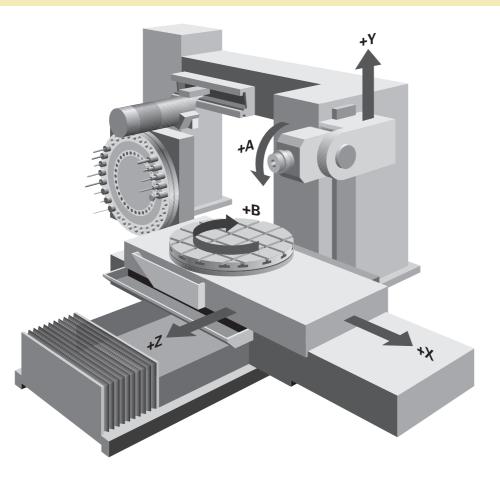

Control Loop Qty.	SIK	ID	SIK2	ID
Additional Axis 1 Additional Axis 2 Additional Axis 3 Additional Axis 4 Additional Axis 5 Additional Axis 6 Additional Axis 7 Additional Axis 8	Option 6	354540-01 353904-01 353905-01 367867-01 367868-01 370291-01 370292-01 370293-01	6-01-1*	1395883-01
4 Additional Axes 8 Additional Axes		634613-01 634614-01	6-01-1*	1395883-01
TNC7 TNC7 basic TNC 640 TNC 620 TNC 320	NC SW 81 NC SW 34 NC SW 34	762x-16 and later 762x-18 and later 1059x-01 and later 1056x-01/73498x-0 1055x-01/771851-0	-	

Installation by the machine manufacturer

For more information, see the Information for Machine Manufacturers brochures

* This software option can be ordered multiple times in the desired quantity. The control automatically takes all enablings into account.

Machine interfacing Integrated functional safety (FS)

Option number

SIK2

6-30-1

1395886-(

6-30-2*

1395887-0

ID

SIK

ID

160

161

162

163

164

165 1249933-01

166

169

1249928-01

1249929-01

1249930-01

1249931-01

1249932-01

1249934-01

1319091-01

Controls featuring integrated functional safety (FS) from HEIDENHAIN can attain Safety Integrity Level 2 (SIL 2) as per EN 61508, and Performance Level "d," Category 3, as per EN ISO 13849-1. In these standards, safety-related systems are assessed based on criteria such as the failure probabilities of integrated components and subsystems. This modular approach aids the manufacturers of safety-related machines in implementing their systems, since they can then build upon prequalified subsystems.

The controls with functional safety (FS) are based on two redundant, mutually independent safety channels. All safetyrelevant signals are collected, processed, and output over two channels. Errors are detected through a reciprocal data comparison of the two channels' states. Consequently, the occurrence of a single error in the control does not cause a loss in safety functionality.

Gen 3 exclusive

For Gen 3 drives, integrated functional safety (FS) is enabled through software options and is scalable. When purchasing these options, you can enable the exact number of safe control loops you actually need.

The machine manufacturer needs the **Add. FS Full** software option if safe control loops are to be enabled via single options and ten or more safe control loops are needed.

The **Add. FS Full** software option enables all remaining FS axes if the following requirements are fulfilled:

- The **Integrated FS: Basic** software option is enabled
- The Add. FS Ctrl. Loop 1 to 5 software options are enabled

Installation by the machine

For more information, see the Technical Information documents

	Option	Comment
01	Integrated FS: Basic	Gen 3 exclusive: enabling of functional safety and of four safe control loops
01	Integrated FS: Full	Gen 3 exclusive: enabling of functional safety and of the maximum number of safe control loops
	FS Control Loop Qty. (Add. FS Ctrl. Loop 1)	Gen 3 exclusive: additional safe control loop (no. 1)
	FS Control Loop Qty. (Add. FS Ctrl. Loop 2)	Gen 3 exclusive: additional safe control loop (no. 2)
	FS Control Loop Qty. (Add. FS Ctrl. Loop 3)	Gen 3 exclusive: additional safe control loop (no. 3)
	FS Control Loop Qty. (Add. FS Ctrl. Loop 4)	Gen 3 exclusive: additional safe control loop (no. 4)
	FS Control Loop Oty. (Add. FS Ctrl. Loop 5)	Gen 3 exclusive: additional safe control loop (no. 5)
	FS Control Loop Qty. (Add. FS Full)	Enabling all remaining FS control loops

* This software option can be ordered multiple times in the desired quantity. The control automatically takes all enablings into account.


Integrated FS: Basic Integrated FS: Full FS Control Loop Qty. (Add. FS Ctrl. Loop 1-5)	Add. FS Full
NC SW 81762x-16 and later NC SW 81762x-18 and later NC SW 34059x-10 and later NC SW 81760x-07 and later	NC SW 81762x-16 and later NC SW 81762x-18 and later NC SW 34059x-11 and later NC SW 81760x-08 and later
nine manufacturer	

Machine interfacing Operating synchronized axes: gantry axes, tandem tables

Synchronized axes are synchronously moving axes that are programmed using the same axis designation.

With HEIDENHAIN controls, parallel axis systems (gantry axes) such as those on portal-type machines or tilting tables can be moved synchronously thanks to highaccuracy, dynamic position control. The fast and particularly precise positioning movements are perfectly harmonized, thus enabling five-axis simultaneous motion for highly demanding tasks. Multiple slave axes can be assigned to a single master gantry axis.

Master-slave torque systems are typically used when large parts need to be moved or when rack and pinion drive systems require pre-stressing for backlash-free motion. Up to six drive systems can be combined into a single master-slave network and mutually pre-stressed as desired. As a result, fast and precise axis positioning becomes attainable even on large machine tools.

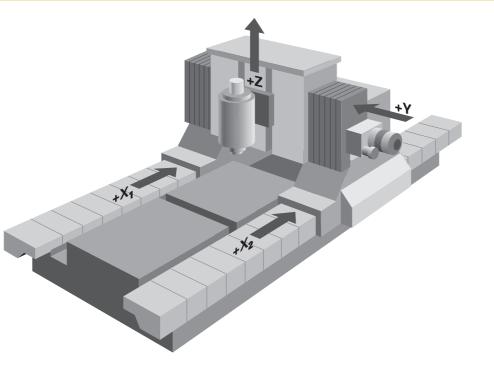

Machine interfacing

Python OEM Process for implementation of special functions

The Python OEM Process software option gives machine manufacturers a powerful tool for using an object-oriented programming language within the control. Python is an easy-to-learn script language supporting all necessary high-level language elements.

Python OEM Process can be employed universally for machine functions, complex calculations, and the display of special user interfaces. User-specific or machine-specific solutions can be efficiently implemented. Regardless of whether you intend to create special algorithms for specialized functions or separate solutions (e.g., interfaces for machine maintenance software), a myriad of existing Python- and GTK-based functions are at your disposal.

MILL D2 ROUGH MILL_D4_ROUGH MILL DS ROUGH MILL_DB_ROUGH MILL DID ROUG MILL D12 ROUGH MILL D14 ROUGH MILL_D16_ROUGH MILL D18 ROUG MILL_D20_ROUGH MILL DZ2_ROUG 100 OCTO

You can integrate your newly created applications through the PLC in familiar PLC windows, or you can display them in your own windows incorporated into the TNC interface, even making them as large as the control's full screen.

Simple Python scripts (e.g., for display masks) can also be executed without enabling the Python OEM Process software option. 10 MB of dedicated memory are reserved for this function. For more information, refer to the Python in HEIDENHAIN Controls Technical Manual

Gantry Axes	SIK	SIK2
	Option 24	6-03-1
	ID 634621-01	ID 1395885-01
TNC7	Standard function	
TNC7 basic	NC SW 81762x-18	and later
TNC 640	Standard function	
TNC 620	NC SW 34056x-01/	73498x-01/81760x-01 and later
TNC 320	NC SW 34055x-01/	771851-01 and later
Installation by the machine r	nanufacturer	

For more information, see the Information for Machine Manufacturers brochures

TNC7 TNC7 basic **TNC 640 TNC 620 TNC 320**

Installation by the machine manufacturer

For more information, see the Information for Machine Manufacturers brochures

SIK



Option 46	7-01-1
ID 579650-01	ID 1395889-01
	8 and later

SIK2

Machine interfacing Short control-loop cycle times for direct drive motors

Position

Single-speed control loops are usually sufficient for linear motors, torque motors, and conventional axes. Double-speed control loops, however, are the go-to choice for HSC spindles and difficult-tocontrol axes. In the control's default settings, all axes are set to single speed. Each axis that is switched from single speed to double speed can reduce the number of available control loops by one. PWM frequencies greater than 5 kHz require double-speed control loops. The Double Speed Axes software option must be enabled for this.

Double-speed control loops permit higher PWM frequencies and shorter speedcontroller cycle times, thereby enabling improved current control for spindles and increased controller performance for linear and torque motors.

Control loop cycle times

Fine interpolation

Single-speed:	0.2 ms
Double-speed:	0.1 ms (with the Double Speed Axes software option)

Position controller

Single-speed:	0.2 ms
Double-speed:	0.1 ms (with the Double Speed Axes software option)

Speed controller

Single-speed: 0.2 ms Double-speed: 0.1 ms (with the Double Speed Axes software option)

Current controller

f _{PWM}	T _{INT}
3333 Hz	150 µs
4000 Hz	120 µs
5000 Hz	100 µs
6666 Hz	75 µs (with the Double Speed Axes software option)
8000 Hz	60 µs (with the Double Speed Axes software option)
10 000 Hz	50 µs (with the Double Speed Axes software option)

Double Speed Axes	SIK	SIK2
	Option 49	6-02-1
	ID 632223-01	ID 1395884-01
TNC7 TNC7 basic TNC 640 TNC 620 TNC 320	NC SW 81762x-16 NC SW 81762x-18 NC SW 34059x-01 NC SW 34056x-01/ -	and later
Installation by the machine ma	anufacturer	

For more information, see the Information for Machine Manufacturers brochures

Machine interfacing OEM options

Machine manufacturers often equip their machine tools with added useful functions stored in the control's configuration parameters (e.g., PLC). These functions are then offered to the user as options. A reserved area in the option menu (SIK) facilitates convenient and versatile enabling of these software options for the user.

Time

0.2 ms / 0.1 ms¹⁾


¹⁾ Single speed/Double speed (with the **Double Speed Axes**

3 ms

software option)

Options 101 to 130 provide thirty options that can be enabled by the machine manufacturer and enabled through his own PLC program. A particular benefit is the user's ability to enable options via the SIK menu without the need for on-site support by the machine manufacturer.

OEM Op	tion
--------	------

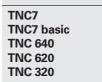

SIK

_

Options 101 to 130 ID 579651-01 to ID 579651-30

NC SW 34059x-02 and later

Machine interfacing Real-time coupling function (RTC) for synchronizing axes and spindles

The Real-Time Coupling function (RTC) enables the cyclical calculation of a position offset for an axis based on the actual and nominal values of any other axes within the system. This function allows complex, simultaneous movements of multiple NC or PLC axes to be implemented. The interdependencies of the axes are defined in mathematical formulas. Possible applications, for example, are in PLC axes that need to be synchronized with an NC axis during a tool change in order to avoid collisions with the tool holders. The machine manufacturer defines these movements with RTC. The real-time coupling function makes complex traversing movements possible through the coupling of principal and secondary axes. Many new solutions are thus made possible, ranging from process-specific movements to tool changes with special requirements.

Software TNCremo programs for data transfer


The free PC software package TNCremo assists the user in transferring data from a PC to HEIDENHAIN controls or programming stations. TNCremo lets you bidirectionally transfer externally stored machining programs, tool tables, pallet tables, and backups of the hard drive, as well as query the operating status of the machine.

Functions:

- Data transfer and file management
- Creation of screenshots of the control
- Reading out of the control log
- Data backup for the control
- Creation of service files

In addition to the features already familiar to you from TNCremo, **TNCremoPlus** can transfer the current content of the control's screen to the PC (live screen). This allows you to implement convenient machine monitoring.

E PLO	Ctext - [PLCtext1*]							-	0 1	×
Da Da	tei Bearbeiten Ansicht Erstell	len Extras Fenster ?							- 16	153
	HH # # 01	N & R & W &							4 51 49 5	
Fehleta	bele Fehlentexte Dialogtexte Hilf	edateien BMX-Texte Zyklentexte	Python-Texte OEM-Texte	Englisch	v					
NR	Verweis auf Fehlertext	Fehlertext	Merker	Reset	Not-Halt	NC-Stopp	NC-Abbruch	F-Stopp	Satzende	2
٥ ٥	#000 Circuit breaker	Circuit breaker	PN_error_circuit_breaker	0	0	1	0	0	0	1
A 1	#001 Temperature drive / inverte	Temperature drive / inverter	PN_error_temp_drives_inverter	0	0	0	0	0	0	
A 2	#002 Hydraulic pressure	Hydraulic pressure	PN_error_hydraulic_pressure	0	0	0	0	0	0	
₫ 3	#003 Pneumatic pressure	Pneumatic pressure	PN_error_pneumatic_pressure	0	0	0	0	0	0	
4	#004 PW 210 temperature max	PW 210 temperature max	PN_error_PW_210_temperature_max	0	0	1	0	0	0	
A 5	#005 DA400 pressure	DA400 pressure	PN_error_DA300_pressure	0	0	0	0	0	0	
16	#006 Power supply drives	Power supply drives	PN_error_supply_servo_drives	0	0	0	0	0	0	
07	#007 power supply PL510 (PL+	power supply PL510 (PL-Nummer		0	1	0	0	0	0	
28	#008 Release M07 for Txxx inacti	Release M07 for Txxx inactive	PN error release coolant circuit	0	0	1	0	0	0	
09	#009 Machine guard is closed !	Machine guard is closed !	PN_error_guard_dosed	0	0	0	0	0	0	
10	#010 Machine guard is open !	Machine guard is open !	PN_error_guard_open	0	0	1	0	0	0	
A 11	#011 Coolant level low	Coolant level low	PN_error_coolant_level_low	0	0	0	0	0	0	
A 12	#012 Lubricating axes	Lubricating axes	PN_error_lubrication_axes	0	0	0	0	0	0	
13	#013 Lubrication oil level low	Lubrication oil level low	PN_error_lubricant_level_low	0	0	0	0	0	0	
14	#014			0	0	0	0	0	0	
15	#015 Servo drive release ->	Servo drive release□ -> Axes	PN_error_servo_drive_release	0	0	0	0	0	0	
A 16	#016		A CONTRACT OF A CONTRACTOR	0	0	0	0	0	0	
17	#017 Central drive	Central drive	PN_error_central_drive	0	0	1	0	0	0	
18	#018 Axes on end position	Axes on end position	PN_error_end_position_axes	0	0	0	0	0	0	
19	=019 Axis motion from end positi	Axis motion from end position	PN_error_axes_motion_from_end_po	0	0	0	0	0	0	
20	=020 Clamping/unclamping axis	Clamping/unclamping axis %s	Ptv_error_damping	0	0	1	0	0	0	
A 21	#021 %s not in hirth position	%is not in hirth position	PN_error_hirth_position	0	0	0	0	0	0	
1 22	#022 Nominal position not in hir	Nominal position not in hirth %s	PN_error_hirth_nominal_position	0	0	0	1	0	0	
23	#023 Drives not operational %s	Drives not operational %s	PN_error_drives_operational	0	0	1	0	0	0	
24	#024 Power stage temperatur	Power stage temperature max %s	PN_error_inverter_temp_max	0	0	1	0	0	0	
25	#025 Drives temperature max	Drives temperature max %s	PN_error_drive_temp_max	0	0	1	0	0	0	
26	#026 Axes i2t pre-warning %s	Axes i2t pre-warning %s	PN_error_12t_pre_warning	0	0	0	0	0	0	
27	#027 Axes (2t limitation %s	Axes 12t limitation %s	PN_error_12t_Imitation	0	0	1	0	0	0	

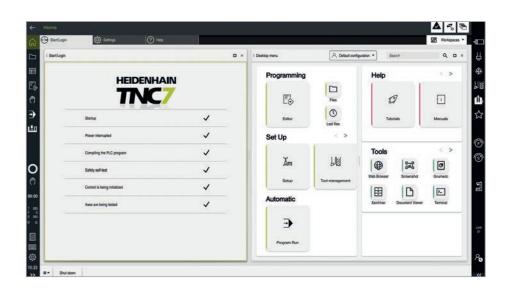

Synchronizing Functions	SIK	SIK2
	Option 135	7-03-1
	ID 1085731-01	ID 1395891-01
TNC7	NC SW 81762x-16	and later
TNC7 basic	_	
TNC 640	NC SW 34059x-04	and later
TNC 620	_	
TNC 320	_	

For more information, see the Information for Machine Manufacturers brochures

TNCremo TNCremoPlus

TNC 640 TNC 620 TNC 320

Installation by the user

Free download
Enabling module requires a fee
ID 340447-xx
NC SW 81762x-16 and later NC SW 81762x-18 and later NC SW 34059x-01 and later NC SW 34056x-01/73498x-01/81760x-01 and later NC SW 34055x-01/771851-01 and later

Software RemoteAccess for remote diagnostics of HEIDENHAIN controls

PC software for remote diagnostics, monitoring and operation

RemoteAccess grants quick and easy access to HEIDENHAIN controls that are installed within the same local network (intranet).

RemoteAccess offers the following functions:

- Display of the control's user interface on the PC
- Operating the control directly through the live view as well as with the integrated keyboard
- HEIDENHAIN PC tools are integrated automatically
- Can be enhanced with OEM-specific applications


Single station license 1339577-01 Network license (14 stations) 1339577-02 Network license (20 stations) 1339577-03

Secure Remote Access (SRA)


The Secure Remote Access enhancement permits setting up an encrypted remote connection to a HEIDENHAIN control via the Internet. Once the SRA connection has been set up, RemoteAccess behaves like a local network connection.

- Possible applications when using SRA:
- User support
- Online seminars
- Diagnostics and service
- Other OEM services

Secure Remote Access enhancement ID 1356741-01

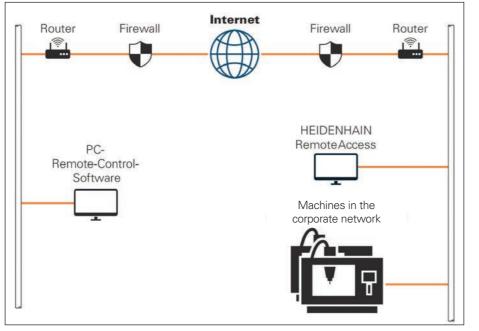

Remote connection over PC remote control software

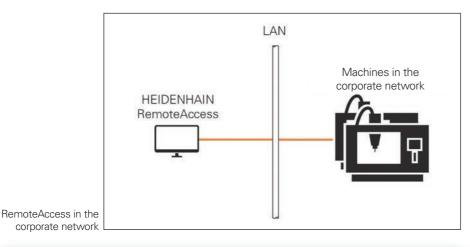

107 - F	Remote/	Access					_	-		×
<u>نې</u>			°,	••	M	Ţ	닪			
TNC7										
Ready									? 🗵	I I N

RemoteAccess	CD with dongle
Single station license	ID 340449-xx
Network lic. for max. 14 participants	ID 340454-xx
Network lic. for max. 20 participants	ID 340455-xx
TNC7	NC SW 81762x-16 and later
TNC7 basic	NC SW 81762x-18 and later
TNC 640	NC SW 34059x-01 and later
TNC 620	NC SW 34056x-01/73498x-01/81760x-01 and later
TNC 320	NC SW 34055x-01/771851-01 and later

Installation by the machine manufacturer

Software

PLCdesign software for developing PLC programs

The PLCdesign software is a convenient way to create PLC programs. It also comes with an extensive selection of sample PLC programs.

Functions

- Management of all project files with integrated project management in an intuitive tree structure • Creation of PLC programs in IL
- Integrated editor with syntax highlighting for PLC programs
- Context-sensitive output windows
- Extensive help functions
- PLC beautifier
- Soft-key creation and generation
- Postprocessor for resolving symbolic operands in generic files
- Support for machine-specific
- configuration • Uploading of all files to the control
- Debug functions: - Source text monitoring - Storage table
- Monitoring list for symbolic operands
- Source-code browser for input wizard and navigation
- Supports source-code control systems

recuesign	
TNC7	
TNC7 basic	

PI Cdocia

TNC 640 TNC 620 TNC 320

For more information, see the Information for Machine Manufacturers brochures

PLCdesign - TNC 640 SW11 - [PLC\plc\program\O File Edit View Project Make Transmit	Debug Tools Extras Window ?	- 0 × - *
		NEFEE JG X BA BUX
LBL	XNYXEXSEDOIOD	
len mog		
Internet Internet Image Devices free Image <td>terring cong confit erring cong confit erring construction terring construction erring construction e</td> <td>• 1 • 2 • 2 • * • * • * • * • * • * • * • *</td>	terring cong confit erring cong confit erring construction terring construction erring construction e	• 1 • 2 • 2 • * • * • * • * • * • * • * • *
Enorip). 0 Werning(s) + 10.29:18		
eceiving machine parameter lies valuating liticonfig settings cading PTX files rished!		
¢		3
dy	10.7.1.42	Ln 1, Col 1 NUM


NC SW 81762x-16 and later	
NC SW 81762x-18 and later	
NC SW 34059x-01 and later	
NC SW 34056x-01/73498x-01/81760x-01	and later
NC SW 34055x-01/771851-01 and later	

Installation by machine manufacturers or servicing providers

Software StateMonitor for collecting and evaluating machine data

The StateMonitor software records and visualizes the statuses of machines in a manufacturing environment. By evaluating important data, such as the current machine status, machine messages, override positions, and utilization history, StateMonitor provides in-depth information about the machines' utilization. This collection of data helps to uncover potential for optimization in order to lower costs and use machines more efficiently.



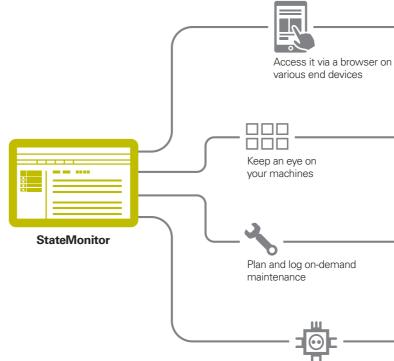

StateMonitor can record and visualize the following information:

- Machine status
- Program status and program name, as well as subprogram names if applicable
- Program run-time
- Machine messages
- Operating mode
- Override positions (spindle, feed rate, rapid traverse)
- SIK number and NC software number
- Maintenance entries and the maintenance history
- Job durations and job quantities
- Other freely definable machine-specific signals
- Machine-specific signal values

Machines can be connected to StateMonitor regardless of the controls they are operated with. The software supports the protocol types HEIDENHAIN DNC, OPC UA, MTConnect, Modbus TCP and FOCAS.

More information is available on the Internet at: https://www.klartext-portal.com/software/ machine-data-collection



StateMonitor 5 Machines MaintenanceManager JobTerminal 5 Signals OPC UA Interface MTConnect Interface Modbus Interface FOCAS Interface	ID 1218930-xx ID 1220884-xx ID 1308520-xx ID 1268674-xx ID 1308521-xx ID 1268673-xx ID 1268675-xx ID 1268670-xx ID 1268670-xx ID 1385356-xx	TNO TNO TNO TNO TNO TNO TNO TNO TNO TNO
FOCAS Interface Data Interface	ID 1385356-xx ID 1367514-xx	псі

Installation by the machine manufacturer or end user

For more information, visit www.digital-shop-floor.heidenhain.com and www.klartext-portal.com, and see the Digital Shop Floor flyer



Get real-time notification by e-mails



Collect and visualize job data





Enhance your tool management





Forwarding to an external SQL database for the processing of machine data in an MES or ERP system

NC7 VC7 basic NC 640 NC 620

NC 320 e following software option ust be enabled: EIDENHAIN DNC

NC SW 81762x-16 and later NC SW 81762x-18 and later NC SW 34059x-01 and later NC SW 34056x-01/73498x-01/ 81760x-01 and later NC SW 34055x-01/771851-01 and later

Software KinematicsDesign for creating machine kinematic models

Software CycleDesign for saving NC subprograms as cycles

KinematicsDesign is a PC software application for the graphically supported creation of kinematic descriptions for HEIDENHAIN controls. It also offers a convenient way to configure and start using the DCM collision monitoring function.


KinematicsDesign can create all objects of the kinematic chain, transfer them to and from the control, and edit them. Extensive visualization possibilities allow the user to display the currently needed information in a clear format. Transformations, collision objects, and designations, for example, can be shown or hidden independently of each other. Collision objects can be shown as wire models, transparently, in full, etc. Colored highlighting makes it easy in KinematicsDesign to discern which collision objects have been checked in relation to each other or are excluded from the collision inspection. These functions are also available in the KinematicsDesign tool directly in the control.

KinematicsDesign visualizes the kinematic model with the current axis positions of a connected control (or programming station) or with manually entered axis positions and displays collisions. In addition, the current tool or a specified tool from a tool table can be shown along with a kinematic model of its tool carrier. KinematicsDesign can import kinematic models from the iTNC 530 and convert them into the format of the NCK controls, as well as generate clamping equipment and tool carrier kinematic models.

The TNC7, TNC7 basic and TNC 640 let you import collision objects from a CAD file and incorporate them as M3D data into the machine kinematics. For the creation of the M3D data, the installation package of KinematicsDesign contains the freestanding PC program M3D Converter.


M3D Converter

This tool can upload, check, repair, simplify, and optimize Step and STL files, thereby preparing them for use as collision objects. In the process, the user can always keep the difference from the original object in view. M3D Converter requires a software release module (ID 1124969-xx).

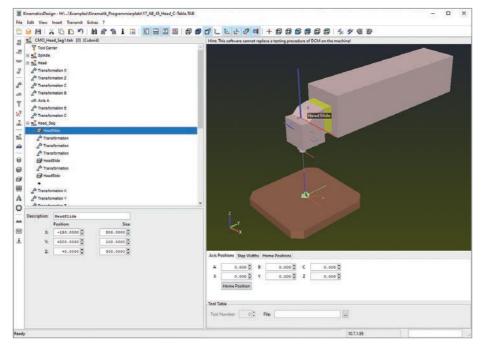

For frequently recurring operations, HEIDENHAIN controls provide you with NC subprograms containing configurable parameters. These subprograms are referred to as cycles. The TNC guides you through the process of entering these parameters with prompts, questions, and help graphics.	E FI
You access the cycles on the control by pressing the CYCL DEF key.	
Using CycleDesign, you can even incorporate your own NC subprograms as cycles into the soft-key structure of the control (or the menu structure of the TNC7 and TNC7 basic). You can choose whether to add your cycles to the HEIDENHAIN cycle bar on the side or completely replace the HEIDENHAIN cycle bar.	

CycleDesign lets you save this cycle data in the control's memory.

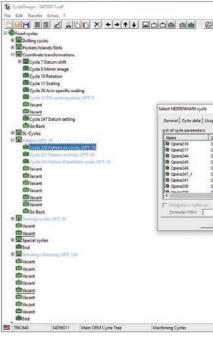

KinematicsDesign	Registration required
TNC7	NC SW 81762x-16 and later
TNC7 basic	NC SW 81762x-18 and later
TNC 640	NC SW 34059x-01 and later
TNC 620	NC SW 34056x-01/73498x-01/81760x-01 and later
TNC 320	NC SW 34055x-01/771851-01 and later
Installation by machine man	
,	the Information for Machine Manufacturers brochures
,	
For more information, see	the Information for Machine Manufacturers brochures
For more information, see M3D Converter	the Information for Machine Manufacturers brochures Enabling module requires a fee
For more information, see M3D Converter	the Information for Machine Manufacturers brochures Enabling module requires a fee ID 1124969-xx
For more information, see M3D Converter TNC7	the Information for Machine Manufacturers brochures Enabling module requires a fee ID 1124969-xx NC SW 81762x-16 and later
For more information, see M3D Converter TNC7 TNC7 basic	the Information for Machine Manufacturers brochures Enabling module requires a fee ID 1124969-xx NC SW 81762x-16 and later NC SW 81762x-18 and later

For more information, see the Information for Machine Manufacturers brochures

CycleDesign

TNC7 TNC7 basic **TNC 640 TNC 620 TNC 320**

Installation by users or machine manufacturers

Qpara216	O216 Center in 1st axis	101	
			11/1
Opara217	Q217 Center in 2nd axis		miert
Opara244	Q244 Pitch circle diameter	-	
Cpara245	Q245 Starting angle		Quiete:
Opara246	Q346 Finishing angle	172	
Qpara247_1	Q247 Angle increment	1	+
Opara241	Q241 Number of operations		
Opara200	Q200 Set-up clearance	1.0	
Canada	Carl Canadianda ad Bar unit	×	


Registration required

NC SW 81762x-16 and later NC SW 81762x-18 and later NC SW 34059x-01 and later NC SW 34056x-01/73498x-01/81760x-01 and later NC SW 34055x-01/771851-01 and later

For more information, see the Information for Machine Manufacturers brochures

TNCscope is a PC oscilloscope software program for machine manufacturers to record and evaluate control signals, drive signals, and PLC operands from HEIDENHAIN controls. TNCscope enables convenient diagnosis from a Windows PC. With a simple Ethernet connection, you can also use TNCscope to perform remote maintenance on the control. The TNCscope software also lets you display oscilloscope files that have been recorded on the control (offline mode). An extensive selection of mathematical functions is available for analysis.

- Multi-channel recording
- Various triggering options
- Convenient analysis of measured values • Display of circular interpolation test and
- XY files of the control • Display of logic-trace files
- Cursor and auxiliary cursors
- Setting of marks
- Measurement and comparison of curves
- Gating of curves with a formula
- Calculation of integrals and derivatives
- XY view
- Frequency analysis with Fast Fourier Transformation (FFT)
- Copying of curves to another file
- Printing of a graph with additional information
- Import function for any ASCII tables
- Long-term measurements
- Recording in batch mode
- Support during the initial setup of various control functions (PAC, LAC, CTC, MAC, ACC, Component Monitoring)

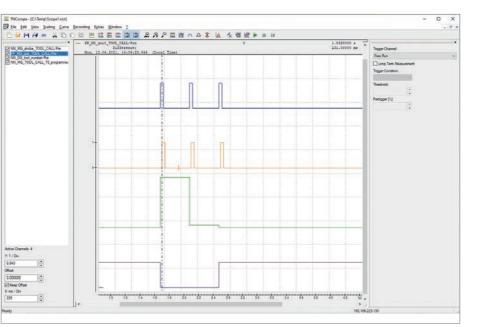

Software TNCdiag for evaluating status information and diagnostic information

Based on the HFL interface (HEIDENHAIN Fiber Link) between the components of the Gen 3 drives, detailed diagnostic possibilities are offered during initial setup and later servicing. To this end, the visualization and presentation of the available diagnostic data have been improved in the TNCdiag software. TNCdiag provides all of the relevant information and statuses of the components in the control system, all the way down to the encoders. This depiction can be component- or axis-specific and is optimized for touch operation. TNCdiag is available as an application on the control for displaying live data and as a PC tool for evaluating diagnostic data, including offline from service files.



- Status and diagnostic information about the HEIDENHAIN components (drive electronics, encoders, input/output devices, etc.) connected to the control
- · History of the recorded data
- Replacement of DriveDiag for Gen 3



TNCdiag

TNC7 TNC7 basic **TNC 640 TNC 620 TNC 320**

Installation by machine manufacturers or servicing providers

For more information, see the Information for Machine Manufacturers brochures

10. 1107502.42 10. 1107502.42 11. (Ches 1) 1 11. (Ches 1) 1 1 1 1 1 1 1 1 1 1 1 1 1	21 (Drive 2)	+ - -
10: 1107962-82 81 (Chire 1) 0	:	+
81 (Orine 1)	:	+
	:	-
	:	-
	:	1
AA.	:	
0 IA	•	
•		
14	0	
•	0	
troller		
eta 🔍	•	
•	•	
•	•	
0	0	
ng has imposéded.	0	
organization of an 1087 has responded.	•	
0	0	

Graphically supported, dynamic display of status signals

Registration required

NC SW 81762x-16 and later NC SW 81762x-18 and later NC SW 34059x-10 and later NC SW 81760x-07 and later

Installation by machine manufacturers or servicing providers

For more information, see the Information for Machine Manufacturers brochures


Software TNCopt for the initial setup of digital control loops

Machine tools with HEIDENHAIN controls must always meet the highest performance standards (surfaces, accuracy, fast and efficient machining, stable machining processes, etc.).

As part of this, exceptional performance is required of the drive system with servo motors and spindles. That's why HEIDENHAIN makes efficient and intelligent closed-loop technology its highest priority. Of particular importance is having the correct control-loop optimization and function settings in the control. TNCopt conveniently helps you keep an overview and follow the proper sequence while setting up the axes.

Functions:

- Initial setup/optimization of the cascade control
- Compensation of peripheral machine influences (friction, hysteresis, etc.)
- System identification
- Dynamic Efficiency / Dynamic Precision
- Measuring functions (circular
- interpolation test, etc.)
- Automated Controller Tuning (ACT)

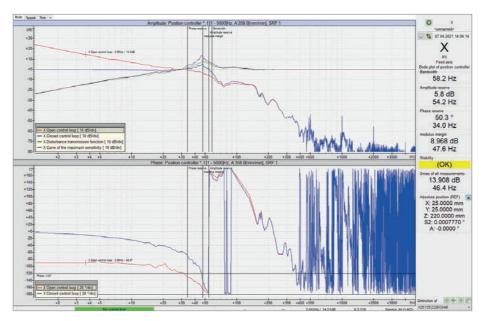

Software IOconfig for configuring inputs and outputs

Modern machine tools are becoming ever more complex and extensively equipped. For this reason, IOconfig allows you to configure all bus systems for HEIDENHAIN controls with all symbolic PLC operands. All required information is stored in a project file (.iocp).

Functions:

- All information is included in one project file • All device descriptions are contained in
- the project file
- Generation of symbol definition files for PLC and SPLC
- Comprehensive option handling for including optional elements in the project
- Simulation mode for direct overview of active and inactive elements
- Convenient operation thanks to modern user interface
- Easy exchange of modules
- Symbol table for straightforward management of PLC symbols
- Definition of PLC start addresses for all elements
- Catalog for device descriptions
- Library for frequently used elements and branches
- Reference project for transferring elements from other projects
- Embedded in PLCdesign as of PLCdesign 3.1

With IOconfig 3, new bus systems are supported by simply adding further bus plug-ins. IOconfig currently includes plugins for SPI, PROFIBUS, PROFINET, and AS interface, as well as MC/PL51x and handwheels. The current device description files and the HEIDENHAIN PROFIBUS PL are also included in delivery.

TNCopt	Registration required
TNC7 TNC7 basic TNC 640 TNC 620 TNC 320	NC SW 81762x-16 and later NC SW 81762x-18 and later NC SW 34059x-04 and later NC SW 81760x-01 and later –
Installation by machine n	nanufacturers or servicing providers
For more information, se	ee the Information for Machine Manufacturers brochures

For more information, see the Information for Machine Manufacturers brochures

10config - C/Daten/Git/plc-basic-mill_de_v14/plc/plc/ioc/TN

. TE 745 ICFG Maschinen Bedienfeld = "TE745"

 T: T2 125 (CFG, Maschinen, Bedienfeld = "TE/25")

 Im Digital Ingeneration

 Im Digital Ingeneration

 Im Digital Ingeneration

 Image: Digital Ingeneration</t

roject * Project > II MC * II HSCI * II HSCI * HSCI_A > II *

PLC Symbol

AS Interface HSCI Bus Bus Master Call Slaves Slaves Slaves F

Plug-in n

Hand PROFINET

1 1 1001 1207	Comment File: condition Debug comment PIC address PIC address PIC address PIC address IM Address I inactive IM			283 IIMD Bit to 1		Note Lary comment Filter conditions for optional Visible in the UO table Operand address ded office Visible in the UO table Operand address ded office Visible options of the operand Mapping mode from the terr The symbol will be written te		AS Interface AS		
						3	Library Reference Project			
								8 :		
5	Name	Address	SPLC Addr.	Type (if inactive)	Addr. # Inactive	Perm, Addr.	Used in SPLC	Module Term	ina	
5 X	L Tante \$22	500		IDMD				<unused></unused>		
	L Taste 533	500		1050				<unused+< td=""><td></td></unused+<>		
	Taste Speenefoerdere	242.5		1050				<unused></unused>		
				10545			2	<unused+< td=""><td></td></unused+<>		
	I HRO Zustimmbetrieb	258								
		258 452		1(M)				«Unused»		
	LHR0_Zustimmbetrieb						2	<unused> <unused></unused></unused>		
	UHRO,Zustimmbetrieb UHRO,NOT,HALT,Krei	452		1(M)						
	LHRQ_Zustimmbetrieb LHR1_NOT_HALT_Kreiss LMB_NOT_HALT_Kreiss	452 450		I(M)				<unused></unused>		
	(HR) Zustimmbetriek (HR) NOT HALT Kreis- (MR) NOT HALT Kreis- (Tatke S. MS), aktiv (Tatke WZM, minus) Tatke WZM, Zustimm	452 450 445		1040 1040 1040			2	<unused></unused>		
	UHRD_Zustimmbetrieb UHR1_NOT_HAAT_Kreis UMB_NOT_HAAT_Kreis (Taste_S_H5_0_aktiv UTaste_WZM_minus.	452 450 445 444		1040 1040 1040 1040				 cUnused> cUnused> cUnused> 	,	

D ' ' '	
Registration	raginrad
rieusialion	reuureu

NC SW 81762x-16 and later NC SW 81762x-18 and later NC SW 34059x-01 and later NC-SW 34056x-01/73495x-01/81760x-01 and later NC SW 77185x-01 and later

nufacturers or servicing providers

Software Enabling of machine manufacturer software options

The software options are saved on the SIK (System Identification Key) plug-in board. Software options can be enabled for up to 90 days at no charge for comprehensive testing.

The plug-in board (SIK or SIK2) determines which of the following applications you use to generate the temporary enabling key for software options of HEIDENHAIN controls:

SIK2

SIK

With the Software Key Generator PC tool: Manual entry of an enabling key

HEIDENHAIN OEM Opti	X Licens	License Request – Choose Options				
\bigcirc	HE	IDENHAIN	Device			101
¥			13965	1-51 - SIK2 -	SIK2 TNC7	E
Software Key Gener	ator	Info	_ Serial I	Number		
Software Key Genera	ator		-			
			Choices		Usage	Options (Tr
This software makes it possib				1395831-51		SW-Option
HEIDENHAIN controls. Thes		ely, but can only be activate	ed ×	1395833-51	×1 ¥	SW-Option
once, and only for a limited ti	me.		x	1395847-51	×1 ¥	SW-Option
Enter the necessary values (") and press "Generate" to g	enerate the desired activat	ion 🛛	1395849-51		SW-Option
code.			0	1395852-51		SW-Option
Tool tips help you automatica	ally when hovering over the e	dit boxes with the mouse		1395855-51		SW-Option
cursor.			•	1395856-51		SW-Option
Serial No. (SN):				1395857-51		SW-Option
			0	1395858-51		SW-Option
* Option:				1395859-51		SW-Option
* Days: 90			0	1395860-51		SW-Option
Days. [30			0	1395862-51		SW-Option
OEM Key:			0	1395863-51		SW-Option
			0	1395864-51		SW-Option
			1 0	1395865-51		SW-Option SW-Option
		Print to file		1395870-51		SW-Option
Activation key:				1395871-51		SW-Option
Activation Key.		Mail		1969011-01		orr-opoon
1		Exit				
Generate		EXIC				

HEIDENHAIN Portal License Key web application	:
A license file is transmitted to the control	
Numer Description Option	

130655	1-51 - SIK2 - 1	SIK2 TA	107	E	
		and In	-	N	
Serial N	umber				
-					
Choices	ID	Usage	8	Options (Trial)	
	1395831-51			SW-Option Adv. Function Set 1 TNC7 TRL 03 Mt., Options number 1-01-1	OEM
×	1395833-51	× 1	۳	SW-Option Opt. Contour Milling OCM TNC7 TRL 03 Mt., Options number 1-02-1	
×	1395847-51	× 1	۲	SW-Option CAD Import TNC7 TRL 03 Mt., Options number 1-03-1	
2	1395849-51			SW-Option CAD Model Optimizer TNC7 TRL 03 Mt., Options number 1-04-1	OEM
	1395852-51			SW-Option Global PGM Settings TNC7 TRL 03 Mt., Options number 1-06-1	OEM
	1395855-51			SW-Option Model Aided Setup MAS TNC7 TRL 03 Mt., Options number 1-07-1	
	1395856-51			SW-Option KinematicsOpt TNC7 TRL 03 Mt , Options number 2-01-1	OEM
	1395857-51			SW-Option 3D-ToolComp TNC7 TRL 03 Mt., Options number 2-02-1	OEM
2	1395858-51			SW-Option Ext. Tool Management TNC7 TRL 03 Mt., Options number 2-03-1	OEM
	1395859-51			SW-Option KinematicsComp TNC7 TRL 03 Mt., Options number 2-04-1	OEM
	1395860-51			SW-Option Batch Process Mngr. BPM TNC7 TRL 03 Mt., Options number 2-05-1	OEM
	1395862-51			SW-Option Cross Talk Comp. CTC TNC7 TRL 03 Mt., Options number 2-20-1	DEM
	1395863-51			SW-Option Position Adapt. Contr. PAC TNC7 TRL 03 Mt., Options number 2-21-1	DEM
	1395864-51			SW-Option Load Adapt. Contr. LAC TNC7 TRL 03 Mt, Options number 2-22-1	OEM
	1395865-51			SW-Option Motion Adapt. Contr. MAC TNC7 TRL 03 Mt., Options number 2-23-1	OEM
	1395869-51			SW-Option Machine Vibr. Contr. MVC TNC7 TRL 03 Mt., Options number 2-24-1	OEM
	1395870-51			SW-Option Active Chatter Contr. ACC TNC7 TRL 03 Mt., Options number 2-30-1	DEM
	1395871-51			SW-Option Adaptive Feed Contr. AFC TNC7 TRL 03 Mt., Options number 2-31-1	OEM

Software BMXdesign

BMXdesign allows you to interactively create BMX project files and final BMX files.

BMX files contain graphical and text elements that can be combined by the control into variants during program run. In this manner, help graphics or soft keys with language-sensitive texts or status-sensitive variants can be combined into just a single file.

200.bmx

BMX files are described in a BMX project file (*.BPJ). BMXdesign generates the final BMX file from the BPJ file.

Available functions:

Step 3/3

- Interactive creation of BMX project files (WYSIWYG)
- Display of BMX files as on the control • Adding and editing graphical and
- text elements
- Positioning of text fields with the mouse • Automatic alignment of fields
- Adding of variants
- · Replacement of database IDs with plainlanguage texts from multi-lingual files
- Printout with page preview
- Generation of BMX files
- Export function as bitmap file (*.BMP)
- Extracting graphic elements from BMX files
- Integration of PLCtext for managing BMX files
- Integration in PLCdesign


Software Key Generator / Web application	Registration required
TNC7 TNC7 basic TNC 640	NC SW 81762x-16 and later NC SW 81762x-18 and later NC SW 34059x-01 and later
TNC 620 TNC 320 Installation by machine manufacturers	NC SW 34056x-03/73498x-01/81760x-01 and later NC SW 34055x-05/771851-01 and later

For more information, see the Information for Machine Manufacturers brochures



Installation by machine manufacturers

For more information, see the Information for Machine Manufacturers brochures

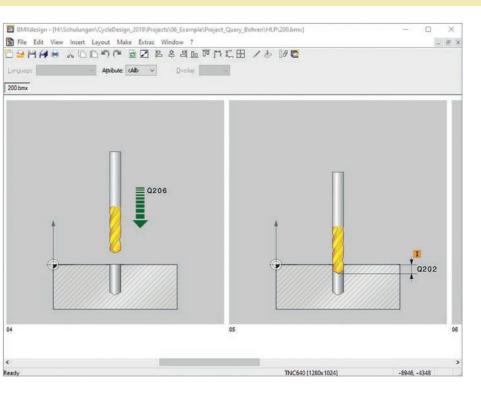

Registration required
NC SW 81762x-16 and later NC SW 81762x-18 and later NC SW 34059x-01 and later NC SW 34056x-01/73498x-01/81760x-01 and later NC SW 34055x-01/771851-01 and later

Software Programming station

Software virtualTNC for control of virtual machines

What's the purpose of a programming station?

As easy as it is to write a part program on a TNC at the machine while a different part is being machined, short reloading times or high machine utilization may hinder attentive programming work on the shop floor. The programming station lets you program the same way you would at the machine but away from all the noise and distractions.

Creating programs

The programming, testing, and optimizing of HEIDENHAIN Klartext or G-code programs with the programming station substantially reduces machine idle times. And it's easy to get used to because every keystroke feels the same: the programming station's keyboard is just like the one on the machine.

Testing programs created offline

Naturally, you can also test programs that were written on a CAD/CAM system. The high-resolution program verification graphics help you easily spot contour damage and hidden details, even in complex 3D programs.

Training with the TNC programming station

Since the programming station is based on the same software as the TNC, it is ideal for apprentice and advanced-level training. Programming is performed on the original keyboard unit. Even the Test Run mode runs exactly as it would on the machine. This gives the trainee the confidence needed to operate a real machine. The programming station is also optimally suited for teaching TNC programming skills in schools, enabling programming in HEIDENHAIN Klartext and with G codes.

What does the programming station look like?

The programming station is an application for PCs with Windows operating systems. The software offers you the same TNC user interface and graphic support as the control of your machine. Depending on the version of the programming station, there are multiple ways of using it.

Which programming stations are available?

Programming stations are available for all current TNC controls. The programming station contains:

- Programming station software
- VirtualBox (VBox) virtualization software from ORACLE
- VBox expansion: TNC VB Base Software and data for the installation and operation of all programming stations (Control Center and virtual keyboard)



TNC7, TNC 640, TNC 620/TNC 320, iTNC 530 programming stations

Wi	th TNC programming station keyboard	ID 1113967-03
Wi	th virtual keyboard	
	Single station license	ID 1113924-04
	Network license, 1 station	ID 1125955-04
	Network license, 14 stations	ID 1113926-04
	Network license, 20 stations	ID 1113928-04
Programming station keyboard		
Ор	erating panel without dongle	ID 1113967-52
ΤN	C7 programming station keyboard	ID 1380256-01

The ability to simulate NC programs on the control has long been a feature of HEIDENHAIN contouring controls. The PC software virtualTNC makes it possible to use TNC controls as a control component for machine-simulation applications on external computer systems.


How a virtual machine with virtualTNC works

Machine simulation applications can fully simulate production units, allowing realworld production processes to be optimized in advance. The virtualTNC software can control the axes of a virtual machine as if it were a real system. Users program and operate the control in the same way as they do an actual HEIDENHAIN control.

virtualTNC is the programming station software of the respective HEIDENHAIN control with a special interface that enables the machine simulation software to identify the current axis positions of the running "virtual" control. In order to simulate the interaction with a real machine, virtualTNC also makes the input and output states of the integrated PLC available.


Connecting virtualTNC over HEIDENHAIN DNC

Software manufacturers who would like to simulate a production system can connect their machine simulation to virtualTNC via HEIDENHAIN DNC. The AxisPositionStreaming interface of the COM component must be used for coupling the axis positions. The JHIOsim DLL is used to read the PLC input and output states. Both are included in the RemoTools SDK development package. A software release module is required to enable the functionality of the interface.

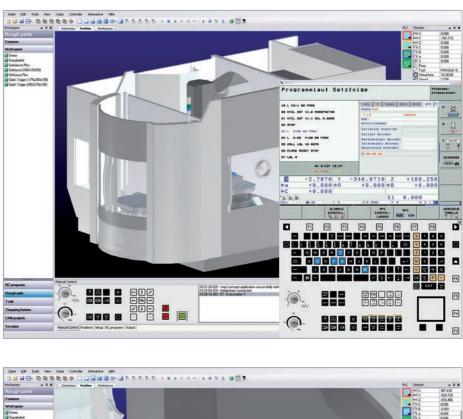



virtualTNC is available f
Single station license
Network license, 1 station
Network license, 14 stat
Network license, 20 sta
Installation by manufac

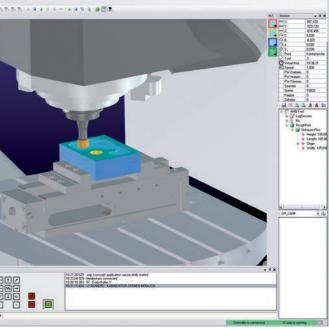

or a fee	TNC7/TNC 640			
	ID 1113933-03			
on	ID 1122145-03			
ions	ID 1113935-03			
tions	ID 1113936-03			
turers of machine simulation applications				

For more information, see the *RemoTools SDK/virtualTNC* brochure

Hardware enhancements HR electronic handwheels

Hardware enhancements TS workpiece touch probes

You can move TNC-controlled machine axes by simply pressing the axis direction keys. A simpler and more sensitive method, however, is to use an electronic handwheel from HEIDENHAIN.

In this case, the feed motor moves the axis slide in direct relation to the handwheel's rotation. For delicate operations, you can incrementally set the distance traveled per handwheel revolution.

HR 130 panel-mounted handwheels The panel-mounted handwheels from

HEIDENHAIN can be integrated into the machine operating panel or mounted at another location on the machine.

HR 510, HR 520, and HR 550 portable handwheels

The HR 510, HR 520, and HR 550 portable handwheels are particularly helpful when you work near the machine's working space. The axis keys and certain function keys are built into the housing. This lets you set up the machine or switch between the axes you want to move from wherever you happen to be standing with the handwheel. The integrated display of the HR 520 and HR 550 handwheels keeps you immediately informed about the most important operating statuses. As a wireless handwheel, the HR 550 is ideal for use on large machines. When you aren't using the handwheel, you can simply place it in the HRA 551 FS handwheel holder (transceiver with integrated charging device).







HR 520





Electronic handwheel With/without detent		TNC7 Minimum NC SW	TNC7 basic Minimum NC SW	TNC 640 Minimum NC SW	TNC 620 Minimum NC SW	TNC 320 Minimum NC SW
HR 130	ID 540940-01/540940-03	81762x-16	81762x-18	34059x-01	34056x-01/73498x-01/81760x-01	34055x-01
HR 510 HR 510FS HR 520 HR 520FS HR 550FS	ID 1120313-xx/1119971-xx ID 1119974-xx/1120311-xx ID 670303-xx/670302-xx ID 670305-xx/670304-xx ID 1183021-xx/1200495-xx	81762x-16 81762x-16 81762x-16 81762x-16 81762x-16 81762x-16	81762x-18 81762x-18 81762x-18 81762x-18 81762x-18 81762x-18	34059x-01 34059x-02 34059x-02 34059x-02 34059x-02	34056x-01/73498x-01/81760x-01 34056x-02/73498x-02/81760x-01 34056x-04/73498x-02/81760x-01 34056x-04/73498x-02/81760x-01 34056x-04/73498x-02/81760x-01	34055x-01 34055x-06 34055x-06 34055x-06 34055x-06
HRA 551 FS for HR 550 FS	ID 1119052-xx	81762x-16	81762x-18	34059x-02	34056x-04/73498x-02/81760x-01	34055x-06

Installation by the machine manufacturer

For more information, see the Information for Machine Manufacturers brochures

Workpiece touch probes from HEIDENHAIN help you reduce cost during shopfloor and serial production. Together with the TNC, touch probes can be used for manual or automatic setup, measuring, and inspection functions:

- Workpiece alignment
- Preset setting
- Workpiece measurement

The touch probes for workpiece measurement are inserted into the tool holder either manually or by a tool changer. Based on the machine, the touch probes can be equipped with various tool shanks. The stylus of a TS touch trigger probe is deflected upon contact with a workpiece surface. In that instant, the TS generates a triggering signal that, depending on the model, is transmitted to the control either by cable, radio transmission, or an infrared beam.

Cable-bound touch probes

For machines requiring manual tool changes, as well as for grinding machines and lathes: TS 260: new generation; axial or radial

cable connection

Wireless touch probes

infrared transmission

With radio or infrared signal transmission for machines with automatic tool changes: TS 460: new-generation standard touch probe for radio and infrared transmission, with compact dimensions, energy-saving mode, optional collision protection, and thermal decoupling **TS 740**: high probing accuracy and repeatability, low probing forces, and



Transceiver

Workpiece touch probes TNC7 TNC7 basic **TNC 640** Minimum Minimum Minimum NC NC SW NC SW TS 260 ID 738283-xx 81762x-16 81762x-18 34059x-05 **TS 460** ID 1178530-xx 81762x-16 81762x-18 34059x-05 **TS 740** ID 573757-xx 81762x-16 81762x-18 34059x-01 **TS 760** ID 1283267-xx 81762x-16 81762x-18 34059x-11 SP 34059x-12 SP 34059x-16 **TS 642** ID 653217-xx 81762x-16 81762x-18 34059x-09

Installation by the machine manufacturer

For more information, see the Touch Probes for Machine Tools brochure

TS 760: highest probing accuracy and repeatability, low probing forces, infrared and radio transmission; for workpiece setup and measuring during machining with integrated workpiece cleaning; EnDat support; energy-saving standby mode

For more information, see the Touch Probes brochure

Radio and infrared communication is established between the TS or TT touch probe and the SE transceiver.



SW	TNC 620 Minimum NC SW	TNC 320 Minimum NC SW
	81760x-02	771851-02
	81760x-02	77185x-02
	34056x-03/73498x-01/81760x-01	340551-05/771851-01
25/ 25/	81760x-07 SP5/81760x-08 SP5/ 81760x-16	-
	81760x-06	77185x-06


Hardware enhancements TT tool touch probes

A key factor in obtaining consistently high production quality is, of course, the tool. This requires the exact measurement of tool dimensions and a cyclical inspection of the tool for wear, breakage, and tooth shape. For tool measurement, HEIDENHAIN offers the TT triggering tool touch probes.


These touch probes are installed directly within the machine's workspace, where they enable tool measurement either before machining or during interruptions.

The TT tool touch probes measure the tool length and radius. During probing of a rotating or stationary tool (e.g., for individual tooth measurement), the contact plate is deflected and a triggering signal is transmitted directly to the TNC. The **TT 160** employs cable-bound signal transmission, whereas the **TT 460** uses radio or infrared transmission. This makes the latter particularly well suited for use on rotary and tilting tables.



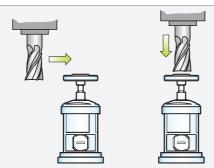

TT tool touch probe Tool length and radius measurement with stationary or rotating spindle

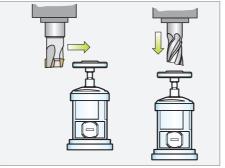

Tool wear measurement and tool breakage monitoring

На	rdware enhancements	
T 1		

The ITC additional operating stations

The additional ITC (Industrial Thin Client) operating stations from HEIDENHAIN are convenient additional remote station solutions for operating the machine or machine units such as tool-changing stations. With a remote operating design tailored to the TNC, the ITC can be readily connected via a standard Ethernet connection with a 100 m (max.) cable.

The ITC 855 is a compact additional operating station for control systems with a 15-inch or 19-inch main screen. In addition to having an ASCII keyboard and a touchscreen, it is also equipped with the most important function keys of the TNC. The ITC 855 adjusts its resolution automatically to fit the size of the main screen. The soft keys are operated on the touchscreen.

Together with the TE 73x or TE 74x keyboard unit, the ITC 362 (24-inch screen with multitouch operation) or ITC 860 (19-inch touchscreen) each make up a full-fledged second operating station. Operation is identical to that of the TNC. The ITC 362 or ITC 860 can also be used as a secondscreen solution for an extended workspace.



ITC 860

Convenient plug-and-play technology

As soon as the TNC detects an ITC, the control provides it with an up-to-date operating system. After the ITC has booted, the main screen is mirrored one-toone. Thanks to this plug-and-play capability, configuration by the machine manufacturer is not needed. With a standard configuration of the X116 Ethernet interface, the TNC automatically integrates the ITC into its system.

You can switch between the TNC and the ITC either by direct takeover or in accordance with a configurable handover principle. Both the booting and shutdown processes are fully controlled by the TNC for maximum operational reliability.

Additional operating station		TNC7 Minimum NC SW	TNC7 basic Minimum NC SW	TNC 640 Minimum NC SW	TNC 620 Minimum NC SW	TNC 320 Minimum NC SW		
ITC 342	ID 1354570-xx	-	81762x-18	-	-	-		
ITC 352	ID 1374639-xx	81762x-18	-	-	-	-		
ITC 362	ID 1346871-xx	81762x-16	-	34059x-07 SP2	-	-		
ITC 855	ID 1370459-01	-	-	34059x-08	81760x-05	-		
ITC 860	ID 1174935-01	-	-	34059x-07 SP2	-	-		
Installation	Installation by the machine manufacturer							

Installation by the machine manufacturer

For more information, see the Information for Machine Manufacturers brochures

Tool touch probes		TNC7	TNC7 basic	TNC 640	TNC 620	TNC 320	
		Minimum NC SW					
Π 160ID 729763-xxΠ 460ID 1192582-xx		81762×16	81762x-18	34059x-05	81760x-02	771851-02	
		81762×16	81762x-18	34059x-05	81760x-02	77185x-02	
Installation by the machine manufacturer							

Installation by the machine manufacturer

For more information, see the Touch Probes for Machine Tools brochure



Hardware enhancements The IPC industrial computer

With the IPC 306 industrial PC, you can start and remotely operate Windows-based applications via the TNC's user interface, for example. The user interface is displayed on the control screen. The Remote **Desktop Manager** software option is required for this.

Since Windows runs on the industrial PC. Windows has no effect on the NC machining process. The IPC is connected to the NC main computer via Ethernet. A second screen is not needed, since the Windows applications are displayed on the TNC's screen via remote access.

In addition to the IPC 306, a separately ordered hard disk is required for operation. The Windows 8 or 10 operating systems can be installed on this empty data medium.



IPC 306

Hardware enhancements VT 121/VT 122 vision systems for tool inspection

The vision systems for tool inspection consist of two components:

- Camera with two objectives (VT 121, VT 122)
- Touch-operated PC software (VTC)

The VT 122 is available in two variants:

- With connections through the base plate for mounting on a prepared machine, or
- With lateral connections for variable cable routing

The vision systems enable tool imaging during machining. Besides documenting tool status and wear, the following applications are possible as well:

- Tool inspection before critical machining steps
- Optimization of cutting parameters
- Optimization of NC programs
- Breakage inspection
- Tool inspection after expiration of tool life

As part of the tool inspection, the camera takes close-up images of each tooth as well as detailed panoramic images of the entire tool circumference. During inspection with the VTC software, the lighting angle can be varied for these panoramic images, enabling optimal illumination of individual teeth. Tools can also be imaged from below. The VTC software can run automatically during unattended shifts (with cycles for TNC controls). Tools that exceed typical wear limits are then automatically disabled by

The vision systems not only help you avoid expensive damage to the tool, workpiece, and machine but even the tool costs themselves can be reduced in the long term through targeted minimization of tool wear. These are the resulting benefits:

- Time savings through keeping the tool in
- the machine • Fewer influences on the process, since the tool does not cool down (such as during microscope inspection in a lab)
- PC software (can be used on its own for later inspection)
- Compact system usable for even large tools
- Rugged design
- Controlled compressed-air cleaning



the NC cycle.



Controls		TNC 640	TNC 620
Industrial PC		Prerequisite: Remote Desktop Manager (option 133)	
IPC 306 With 8 GB of RAM	ID 1179966-01		
SSDR IPC 306	ID 1282884-51	Data medium for operating system	
Installation by the ma	chine manufacturer		

For more information, see the Information for Machine Manufacturers brochures

Vision system Tool Inspection		TNC7 Minimum NC SW	TNC7 basic Minimum NC SW	TNC 640 Minimum NC SW	TNC 620 Minimum NC SW	TNC 320 Minimum NC SW
VT 121	1249466-01	81762x-16	81762x-18	34059x-10	-	-
VT 122	1373589-xx	81762x-18	81762x-18	34059x-10	-	-
Installation by th	a maahina manufaat	uror.				

Installation by the machine manufacturer

For more information, see the VT 121 Vision System for Tool Inspection Product Information document

• Automated imaging during machining

The sealed and highly rugged vision systems are designed to be installed inside the machine's work envelope. They require compressed air only during tool clearing cycles. The vision systems can be employed regardless of whether cooling lubricant is used or dry machining is performed. Compressed air from the integrated jets cleans the tools and the camera's cover glass. An optimal cleaning strategy ensures removal of nearly all chips. The camera systems can be connected via their Gigabit Ethernet interface.









HEIDENHAIN

www.heidenhain.com

827222-2B · 04/2025 · F&W · Printed in Germany



HEIDENHAIN worldwide